

AD-A105 523 ANDERSON ENGINEERING INC SPRINGFIELD MO
NATIONAL OAS SAFETY PROGRAM

ANDERSON ENGINEERING INC SPRINGFIELD MO
NATIONAL DAM SAFETY PROGRAM, BURTON DUENKE NUMBER 1 LAKE DAM (M--ETC(U)
AUG 80 @ WERTEPNY, D KERNS, S L BRADY
F/6 13/13
DACW43-80-C-0073

DACW43-80-C-0073

NL

10x10 grid of frames. The bottom row contains a small white box with the text: END DATE FILMED 11-81 DTIC

AD A105523

LEVEL

①

11

CHANGING COLLAGE WITH NAME

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

REPORT DOCUMENTATION PAGE		READ INSTRUCTIONS BEFORE COMPLETING FORM
1. REPORT NUMBER	2. GOVT ACCESSION NO. AD-A105	3. RECIPIENT'S CATALOG NUMBER 523
4. TITLE (and Subtitle) Phase I Dam Inspection Report National Dam Safety Program Duenke, Burton Lake No. 1 (MO 31610) Camden County, Missouri		5. TYPE OF REPORT & PERIOD COVERED Final Report
7. AUTHOR(s) Anderson Engineering, Inc.		6. PERFORMING ORG. REPORT NUMBER
9. PERFORMING ORGANIZATION NAME AND ADDRESS U.S. Army Engineer District, St. Louis Dam Inventory and Inspection Section, LMSED-PD 210 Tucker Blvd., North, St. Louis, Mo. 63101		8. CONTRACT OR GRANT NUMBER(s) 15 DACW43-80-C-0073
11. CONTROLLING OFFICE NAME AND ADDRESS U.S. Army Engineer District, St. Louis Dam Inventory and Inspection Section, LMSED-PD 210 Tucker Blvd., North, St. Louis, Mo. 63101		10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS 11
14. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office) 12 56		12. REPORT DATE August 1980
		13. NUMBER OF PAGES Approximately 50
		15. SECURITY CLASS. (of this report) UNCLASSIFIED
16. DISTRIBUTION STATEMENT (of this Report) Approved for release; distribution unlimited.		15a. DECLASSIFICATION/DOWNGRADING SCHEDULE
17. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from Report) 6 National Dam Safety Program. Burton Duenke Number 1 Lake Dam (MO 31610), Osage - Gasconade River Basin, Camden County, Missouri. Phase I Inspection Report.		
18. SUPPLEMENTARY NOTES		
19. KEY WORDS (Continue on reverse side if necessary and identify by block number) Dam Safety, Lake, Dam Inspection, Private Dams		
20. ABSTRACT (Continue on reverse side if necessary and identify by block number) This report was prepared under the National Program of Inspection of Non-Federal Dams. This report assesses the general condition of the dam with respect to safety, based on available data and on visual inspection, to determine if the dam poses hazards to human life or property.		

DD FORM 1 JAN 73 1473

EDITION OF 1 NOV 65 IS OBSOLETE

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

412554

INSTRUCTIONS FOR PREPARATION OF REPORT DOCUMENTATION PAGE

RESPONSIBILITY. The controlling DoD office will be responsible for completion of the Report Documentation Page, DD Form 1473, in all technical reports prepared by or for DoD organizations.

CLASSIFICATION. Since this Report Documentation Page, DD Form 1473, is used in preparing announcements, bibliographies, and data banks, it should be unclassified if possible. If a classification is required, identify the classified items on the page by the appropriate symbol.

COMPLETION GUIDE

General. Make Blocks 1, 4, 5, 6, 7, 11, 13, 15, and 16 agree with the corresponding information on the report cover. Leave Blocks 2 and 3 blank.

Block 1. Report Number. Enter the unique alphanumeric report number shown on the cover.

Block 2. Government Accession No. Leave Blank. This space is for use by the Defense Documentation Center.

Block 3. Recipient's Catalog Number. Leave blank. This space is for the use of the report recipient to assist in future retrieval of the document.

Block 4. Title and Subtitle. Enter the title in all capital letters exactly as it appears on the publication. Titles should be unclassified whenever possible. Write out the English equivalent for Greek letters and mathematical symbols in the title (see "Abstracting Scientific and Technical Reports of Defense-sponsored RDT/E," AD-667 000). If the report has a subtitle, this subtitle should follow the main title, be separated by a comma or semicolon if appropriate, and be initially capitalized. If a publication has a title in a foreign language, translate the title into English and follow the English translation with the title in the original language. Make every effort to simplify the title before publication.

Block 5. Type of Report and Period Covered. Indicate here whether report is interim, final, etc., and, if applicable, inclusive dates of period covered, such as the life of a contract covered in a final contractor report.

Block 6. Performing Organization Report Number. Only numbers other than the official report number shown in Block 1, such as series numbers for in-house reports or a contractor/grantee number assigned by him, will be placed in this space. If no such numbers are used, leave this space blank.

Block 7. Author(s). Include corresponding information from the report cover. Give the name(s) of the author(s) in conventional order (for example, John R. Doe or, if author prefers, J. Robert Doe). In addition, list the affiliation of an author if it differs from that of the performing organization.

Block 8. Contract or Grant Number(s). For a contractor or grantee report, enter the complete contract or grant number(s) under which the work reported was accomplished. Leave blank in in-house reports.

Block 9. Performing Organization Name and Address. For in-house reports enter the name and address, including office symbol, of performing activity. For contractor or grantee reports enter the name and address of the contractor or grantee who prepared the report and identify the appropriate corporate division, school, laboratory, etc., of the author. List city, state, and ZIP Code.

Block 10. Program Element, Project, Task Area, and Work Unit Numbers. Enter here the number code from the applicable Department of Defense form, such as the DD Form 1498, "Research and Technology Work Unit Summary" or the DD Form 1634, "Research and Development Planning Summary," which identifies the program element, project, task area, and work unit or equivalent under which the work was authorized.

Block 11. Controlling Office Name and Address. Enter the full, official name and address, including office symbol, of the controlling office. (Equates to funding/sponsoring agency. For definition see DoD Directive 5200.20, "Distribution Statements on Technical Documents.")

Block 12. Report Date. Enter here the day, month, and year or month and year as shown on the cover.

Block 13. Number of Pages. Enter the total number of pages.

Block 14. Monitoring Agency Name and Address (if different from Controlling Office). For use when the controlling or funding office does not directly administer a project, contract, or grant, but delegates the administrative responsibility to another organization.

Blocks 15 & 15a. Security Classification of the Report: Declassification/Downgrading Schedule of the Report. Enter in 15 the highest classification of the report. If appropriate, enter in 15a the declassification/downgrading schedule of the report, using the abbreviations for declassification/downgrading schedules listed in paragraph 4-207 of DoD 5200.1-R.

Block 16. Distribution Statement of the Report. Insert here the applicable distribution statement of the report from DoD Directive 5200.20, "Distribution Statements on Technical Documents."

Block 17. Distribution Statement (of the abstract entered in Block 20, if different from the distribution statement of the report). Insert here the applicable distribution statement of the abstract from DoD Directive 5200.20, "Distribution Statements on Technical Documents."

Block 18. Supplementary Notes. Enter information not included elsewhere but useful, such as: Prepared in cooperation with ... Analated of (or by) ... Presented at conference of ... To be published in ...

Block 19. Key Words. Select terms or short phrases that identify the principal subjects covered in the report, and are sufficiently specific and precise to be used as index entries for cataloging, conforming to standard terminology. The DoD "Thesaurus of Engineering and Scientific Terms" (TEST), AD-672 000, can be helpful.

Block 20. Abstract. The abstract should be a brief (not to exceed 200 words) factual summary of the most significant information contained in the report. If possible, the abstract of a classified report should be unclassified and the abstract to an unclassified report should consist of publicly-releasable information. If the report contains a significant bibliography or literature survey, mention it here. For information on preparing abstracts see "Abstracting Scientific and Technical Reports of Defense-Sponsored RDT&E," AD-667 000.



DEPARTMENT OF THE ARMY
ST. LOUIS DISTRICT, CORPS OF ENGINEERS
210 TUCKER BOULEVARD, NORTH
ST. LOUIS, MISSOURI 63101

REPLY TO
ATTENTION OF

SUBJECT: Burton Duenke No. 1 Lake Dam Phase I Inspection Report

This report presents the results of field inspection and evaluation of the Burton Duenke No. 1 Lake Dam (MO 31610).

It was prepared under the National Program of Inspection of Non-Federal Dams.

This dam has been classified as unsafe, non-emergency by the St. Louis District as a result of the application of the following criteria:

- a. Spillway will not pass 50 percent of the Probable Maximum Flood without overtopping the dam.
- b. Overtopping of the dam could result in failure of the dam.
- c. Dam failure significantly increases the hazard to loss of life downstream.

SIGNED

SIGNED

29 AUG 1980

SUBMITTED BY

Chief, Engineering Division

Date

APPROVED BY:

SIGNED

29 AUG 1980

Colonel, CE, District Engineer

Date

Accession For	
NTIS GRA&I	<input checked="" type="checkbox"/>
DTIC TAB	<input type="checkbox"/>
Unannounced	<input type="checkbox"/>
Justification	<input type="checkbox"/>
Fy. _____	
Distribution/	
Availability to _____	
Dist. _____	
A	

OSAGE-GASCONADE RIVER BASIN

BURTON DUENKE NO. 1 LAKE DAM

CAMDEN COUNTY, MISSOURI

MISSOURI INVENTORY NO. 31610

PHASE I INSPECTION REPORT
NATIONAL DAM SAFETY PROGRAM

Prepared By

Anderson Engineering, Inc., Springfield, Missouri
Hanson Engineers, Inc., Springfield, Illinois

Under Direction Of

St. Louis District, Corps of Engineers

For

Governor of Missouri

June, 1980

PHASE I REPORT
NATIONAL DAM SAFETY PROGRAM
SUMMARY

Name of Dam: Burton Duenke No. 1 Lake Dam
State Located: Missouri
County Located: Camden County
Stream: Tributary of Lake of the Ozarks
Date of Inspection: April 29, 1980

Burton Duenke No. 1 Lake Dam was inspected by an interdisciplinary team of engineers from Anderson Engineering, Inc. of Springfield, Missouri and Hanson Engineers, Inc. of Springfield, Illinois. The purpose of this inspection was to make an assessment of the general condition of the dam with respect to safety, based upon available data and visual inspection, in order to determine if the dam poses hazards to human life or property.

The guidelines used in the assessment were furnished by the Department of the Army, Office of the Chief of Engineers, and they have been developed with the help of several Federal and State agencies, professional engineering organizations, and private engineers. Based on these guidelines, the St. Louis District, Corps of Engineers has determined that this dam is in the high hazard potential classification, which means that loss of life and appreciable property loss could occur if the dam fails. The estimated damage zone extends approximately one mile downstream of the dam. Located within this zone are one dam, one dwelling, 13 trailers, several boat docks and a marina. The dam is in the small size classification, since it is greater than 25 ft high but less than 40 ft high, and the maximum storage capacity is greater than 50 ac-ft but less than 1000 ac-ft.


~~Our~~ inspection and evaluation indicates that the spillway does not meet the criteria set forth in the guidelines for a dam having the above size and hazard potential. The spillway will pass 19 percent of the Probable Maximum Flood without overtopping. The Probable Maximum Flood is defined as the flood discharge that may be expected from the most severe combination of critical meteorologic and hydrologic conditions that are reasonably possible in the region. The guidelines require that a dam of small size with a high downstream hazard potential pass 50 to 100 percent of the PMF. Considering the height of the dam (36 feet), the volume of water impounded (53 acre-foot), and the dwellings downstream, 50 percent of the PMF has been determined to be the appropriate spillway design flood.

The 1 percent probability flood will not overtop the dam. The 1 percent probability flood is one that has a 1 percent chance of being equalled or exceeded in any given year.


The embankment appeared to be in less than satisfactory condition. Deficiencies visually observed by the inspection team were: (1) Some small trees on the front face of the embankment; (2) Weed growth on the downstream face of embankment; (3) Minor erosion at abutment-downstream embankment contact; (4) Brush and debris partially blocking the spillway pipe outlet; (5) Soft marshy area at the downstream toe near center of the dam, (6) Lack of wave protection for the upstream face of the embankment; and (7) Lack of trash screen at the inlet to the spillway pipe.

Another deficiency was the lack of seepage and stability analysis records.


It is recommended that the owners take the necessary action without undue delay to correct the deficiencies reported herein. A detailed discussion of these deficiencies is included in the following report.

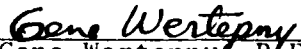


Gene Wertepny, P.E.
Hanson Engineers, Inc.

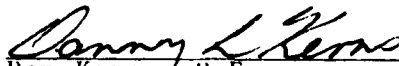

Dan Kerns, P.E.
Hanson Engineers, Inc.



Steven L. Brady, P.E.
Anderson Engineering, Inc.

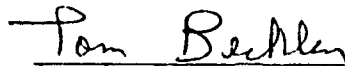

Tom Beckley, P.E.
Anderson Engineering, Inc.



AERIAL VIEW OF LAKE AND DAM

PHASE 1 INSPECTION REPORT
NATIONAL DAM SAFETY PROGRAM

BURTON DUENKE NO. 1 LAKE DAM
MISSOURI INVENTORY NO. 31610

TABLE OF CONTENTS

<u>Paragraph No.</u>	<u>Title</u>	<u>Page No.</u>
	SECTION 1 - PROJECT INFORMATION	
1.1	General	1
1.2	Description of the Project	1
1.3	Pertinent Data	3
	SECTION 2 - ENGINEERING DATA	
2.1	Design	7
2.2	Construction	8
2.3	Operation	8
2.4	Evaluation	9
	SECTION 3 - VISUAL INSPECTION	
3.1	Findings	10
3.2	Evaluation	11
	SECTION 4 - OPERATIONAL PROCEDURES	
4.1	Procedures	12
4.2	Maintenance of Dam	12
4.3	Maintenance of Operating Facilities	12
4.4	Description of Any Warning System in Effect	12
4.5	Evaluation	12
	SECTION 5 - HYDRAULIC/HYDROLOGIC	
5.1	Evaluation of Features	13
	SECTION 6 - STRUCTURAL STABILITY	
6.1	Evaluation of Structural Stability	15
	SECTION 7 - ASSESSMENT/REMEDIAL MEASURES	
7.1	Dam Assessment	16
7.2	Remedial Measures	17

APPENDICES

Sheet

APPENDIX A

Location Map
Vicinity Map
Plan, Profile and Section of Dam
Plan Sketch of Dam
Map of Area Dams

1
2
3
4
5

APPENDIX B

Geologic Regions of Missouri
Thickness of Loessial Deposits

1
2

APPENDIX C

Overtopping Analysis - PMF

1 - 9

APPENDIX D

Photograph Index
List of Photographs
Photographs of Dam and Lake

1
2
3 - 4

SECTION 1 - PROJECT INFORMATION

1.1 GENERAL:

A. Authority.

The National Dam Inspection Act, Public Law 92-367, authorized the Secretary of the Army, through the Corps of Engineers, to initiate a program of safety inspection of dams throughout the United States. Pursuant to the above, the St. Louis District, Corps of Engineers, District Engineer directed that a safety inspection be made of Burton Duenke No. 1 Lake Dam in Camden County, Missouri.

B. Purpose of Inspection:

The purpose of the inspection was to make an assessment of the general condition of the dam with respect to safety, based upon available data and a visual inspection in order to determine if the dam poses hazards to human life or property.

C. Evaluation Criteria:

Criteria used to evaluate the dam were furnished by the Department of the Army, Office of the Chief of Engineers, "Recommended Guidelines for Safety Inspection of Dams, Appendix D. These guidelines were developed with the help of several federal agencies and many state agencies, professional engineering organizations, and private engineers.

1.2 DESCRIPTION OF PROJECT:

A. Description of Dam and Appurtenances:

Burton Duenke No. 1 Lake Dam is an earth fill structure approximately 36 ft high and 450 ft long at the crest. The appurtenant work consists of a 30 inch diameter uncontrolled CMP spillway located near the west abutment.

Sheet 3 of Appendix A shows a plan profile and typical section of the embankments.

B. Location:

The dam is located in the north central part of Camden County, Missouri on a tributary of Lake of the Ozarks. The dam and lake are within the Lake Ozark, Missouri 7.5 minute quadrangle sheet (Section 08, T39N, R16W - latitude 38°08.0 ; longitude 92°42.0). Sheet 2 of Appendix A shows the general vicinity.

C. Size Classification:

With an embankment height of 36 ft and a maximum storage capacity of approximately 53 acre-ft, the dam is in the small size category.

D. Hazard Classification:

The St. Louis District, Corps of Engineers has classified this dam as a high hazard dam. The estimated damage zone extends approximately one mile downstream of the dam. Located within this zone are one dam, one dwelling, 13 trailers, several boat docks and a marina. The affected-downstream hazard zone was verified by the inspection team.

E. Ownership:

The dam is owned by Tan-Tar-A Development, a part of Burton Duenke Development. The owner's address is P. O. Box 213-32, Osage Beach, Missouri 65065.

F. Purpose of Dam:

The dam was constructed primarily for lakeside home and golf course development.

G. Design and Construction History:

No design information or plans are available. The dam was built by Tan Tar-A Development Corporation with Mr. Wes Westhoff as project supervisor. The dam was constructed in 1971 by the work force and equipment of the Development Corporation.

Mr. Westhoff reported that a core trench about 20 feet wide was excavated to rock. The average depth of the trench was estimated to be 8 feet. The material for construction of the dam was obtained from the lake area. Compaction of the trench material and the embankment was by use of a D-8 dozer. There is no internal drainage or particular zoning of the embankment.

The spillway pipe was sized by Mr. Westhoff for a storm of 30 year recurrence interval for the estimated drainage area. An ArmcO drainage design data card was used for this design.

An asphalt golf cart trail, 2 inch water line and adjacent golf course were constructed in 1979.

No additional modifications to the dam have been reported since the initial construction.

II. Normal Operating Procedures:

All flows will be passed by the uncontrolled corrugated metal spillway pipe. Information obtained from the superintendent indicates that the dam has never been overtopped.

1.3 PERTINENT DATA:

Pertinent data about the dam, appurtenant works, and reservoir are presented in the following paragraphs. Sheet 3 of Appendix A presents a plan, profile and typical section of the embankment.

A. Drainage Area:

The drainage area for this dam, as obtained from the U.S.G.S. quad sheet and a 1 foot contour interval map obtained from the owner, is approximately 40 acres.

B. Discharge at Dam Site:

- (1) All discharge at the dam site is through an uncontrolled spillway.
- (2) Estimated Total Spillway Capacity at Maximum Pool (Top of Dam - El. 751.3): 24 cfs
- (3) Estimated Capacity of Primary Spillway: 24 cfs
- (4) Estimated Experience Maximum Flood at Dam Site: Unknown
- (5) Diversion Tunnel Low Pool Outlet at Pool Elevation: Not Applicable
- (6) Diversion Tunnel Outlet at Pool Elevation: Not Applicable
- (7) Gated Spillway Capacity at Pool Elevation: Not Applicable
- (8) Gated Spillway Capacity at Maximum Pool Elevation: Not Applicable

C. Elevations:

All elevations are consistent with an assumed mean sea level elevation of 748.36 for the invert of the spillway inlet pipe (elevation obtained from owner).

- (1) Top of Dam: 751.3 feet (Ave.), MSL
- (2) Principal Spillway Pipe Invert: 748.36 feet, MSL
- (3) Emergency Spillway Crest: Not Applicable
- (4) Principal Outlet Pipe Invert At Outlet End: 746.74 feet, MSL
- (5) Streambed at Centerline of Dam: 718.0 feet, MSL
- (6) Pool on Date of Inspection. 748.6 feet, MSL
- (7) Apparent High Water Mark: Unknown
- (8) Maximum Tailwater: Unknown
- (9) Upstream Portal Invert Diversion Tunnel. Not Applicable
- (10) Downstream Portal Invert Diversion Tunnel: Not Applicable

D. Reservoir Lengths:

- (1) At Top of Dam. 860 feet
- (2) At Principal Spillway Crest: 800 feet
- (3) At Emergency Spillway Crest: Not Applicable

E. Storage Capacities.

- (1) At Principal Spillway Crest: 42 acre-feet
- (2) At Top of Dam: 53 acre-feet
- (3) At Emergency Spillway Crest: Not Applicable

F. Reservoir Surface Areas.

- (1) At Principal Spillway Crest: 3.7 acres
- (2) At Top of Dam. 4.2 acres
- (3) At Emergency Spillway Crest: Not Applicable

G. Dam.

- (1) Type: Earth Fill
- (2) Length at Crest: 450 feet
- (3) Height: 36 feet
- (4) Top Width: 32 feet
- (5) Side Slopes: Upstream 2H:1V; Downstream 2.6H:1V and 4.1H:1V
- (6) Zoning: Apparently Homogeneous
- (7) Impervious Core: None
- (8) Cutoff: Key trench to bedrock
- (9) Grout Curtain: None

H. Diversion and Regulating Tunnel:

- (1) Type. Not Applicable
- (2) Length: Not Applicable
- (3) Closure: Not Applicable
- (4) Access: Not Applicable
- (5) Regulating Facilities: Not Applicable

I. Spillway.

I.1 Principal Spillway:

- (1) Location: Station 0 + 15 (near west abutment)
- (2) Type. 30 inch diameter corrugated metal pipe

I.2 Emergency Spillway:

- (1) Location: None
- (2) Type: Not Applicable

J. Regulating Outlets:

There are no regulating facilities associated with this dam.

SECTION 2 - ENGINEERING DATA

2.1 DESIGN:

No design computations or reports for this dam are available. No documentation of construction inspection records are known to exist. To our knowledge there are no documental maintenance data.

A. Surveys.

No information regarding pre-construction surveys was able to be obtained. The inlet-invert of the 30 inch diameter CMP was used as a site datum for one survey. The invert elevation of 748.36 mean sea level elevation was obtained from the owner from a post-construction survey. This survey consisted of determining mean sea level elevations for the inverts of the owner's dams in the area.

B. Geology and Subsurface Materials:

The site is located in the west-central portion of the Ozarks geologic region of Missouri. The Ozarks are characterized topographically by hills, plateaus and deep valleys. The most common bedrock types are dolomite, sandstone and chert. The "Geologic Map of Missouri" indicates that the bedrock in the area consists primarily of the Gasconade formation of the Canadian Series in the Ordovician System. The Gasconade formation is predominantly a light brownish-gray, cherty dolomite. In the central Ozarks region, the average thickness of the Gasconade is 300 feet. Caves and springs are common in this formation.

The publication "Caves of Missouri" indicates that fifteen known caves exist in Camden County; 3 of these caves are located within 10 miles of the site. In addition, three caves in adjacent Miller County and one cave in adjacent Morgan County are located within 10 miles of the site. The closest known cave is about 5 miles southeast of the site.

The "Geologic Map of Missouri" indicates a normal fault passing about 3 miles north of the site in a northwest-southeast direction. The Missouri Geologic Survey has indicated that the faults in this area are generally considered to be inactive and have been for several hundred million years.

The soils in the area of the dam are of the Clarksville-Fullerton-Talbott soil association. These soils have developed from cherty limestone and dolomite. The thickness of loessial deposits in upland areas may range from 2.5 feet to 5.0 feet.

Information from the Soil Conservation Service indicates that the soils in this area "consist of deep and moderately deep, well drained, moderately permeable soils that formed in clayey residium weathered from cherty dolomitic limestone bedrock." The predominant Clarksville soil consists of a yellowish-red very cherty, silty clay loam.

C. Foundation and Embankment Design:

No design computations are available. Seepage and stability analyses apparently were not performed as required in the guidelines. There is apparently no particular zoning of the embankment and no internal drainage features are known to exist.

D. Hydrology and Hydraulics:

No hydrologic or hydraulic design computations for this dam were available. Based on a field check of spillway dimensions and embankment elevations, and a check of the drainage area on U.S.G.S. quad sheets and on a contour map obtained from the owner, hydrologic analyses using U. S. Army Corps of Engineers guidelines were performed and appear in Appendix C, Sheets 1 to 8.

E. Structure:

There are no structures associated with Burton Duenke Lake Dam No. 1.

2.2 CONSTRUCTION:

No construction inspection data have been obtained.

2.3 OPERATION:

Normal flows are passed by the 30 inch diameter corrugated metal pipe located at the east abutment. No operating facilities exist.

2.4 EVALUATION.

A. Availability:

No engineering data, seepage or stability analyses, or construction test data were available.

B. Adequacy:

The engineering data available were inadequate to make a detailed assessment of the design, construction, and operation of this structure. Seepage and stability analyses comparable to the requirements of the "Recommended Guidelines for Safety Inspection of Dams" were not available, which is considered a deficiency. These seepage and stability analyses should be performed for appropriate loading conditions (including earthquake loads) and made a matter of record.

C. Validity:

To our knowledge, no valid engineering data on the design or construction of the embankment are available.

SECTION 3 - VISUAL INSPECTION

3.1 FINDINGS.

A. General:

The field inspection was made on April 29, 1980. The inspection team consisted of personnel from Anderson Engineering, Inc. of Springfield, Missouri and Hanson Engineers, Inc. of Springfield, Illinois. The team members were:

Steven L. Brady - Anderson Engineering, Inc. (Civil Engineer)
Tom Beckley - Anderson Engineering, Inc. (Civil Engineer)
Gene Wertepny - Hanson Engineers, Inc. (Hydraulic Engineer)
Dan Kerns - Hanson Engineers, Inc. (Geotechnical Engineer)

Photographs of the dam, appurtenant structures, reservoir, and downstream features are presented in Appendix D.

B. Dam:

The dam appears to be in less than satisfactory condition. No sloughing of the embankment was noted. The horizontal and vertical alignments of the crest appeared good, and no surface cracking or unusual movement was obvious. The crest of the embankment was 32 feet wide and the average elevation was 751.3 (top of asphalt golf cart trail) MSL.

The upstream face of the embankment has a slope of 1.25H to 1V from the crest to the water surface. No rip rap or other method of wave protection was noted. The face of the embankment has numerous small trees and dense vegetation, which made inspection difficult. No serious erosion or sloughing was observed on the upstream face of the embankment.

The downstream face of the embankment has a slope of from 2.01H:1V to 4.11H:1V from the crest to the embankment toe. Minor erosion channels were observed at the abutment-embankment contact. Considerable brush and weeds were noted on the downstream slope of the embankment. At the downstream toe of the embankment a soft and marshy area was noted. A dense growth of cattails was present in this area. No noticeable flow could be detected from the marshy area. No apparent discoloration of the surrounding soil was observed.

The dam immediately downstream of Burton Duenke No. 1 was constructed in 1979. The pool level in this lake on the date of inspection was approximately 10 feet below normal pool elevation.

Shallow auger probes into the embankment indicates the dam to consist of a reddish-brown sandy clay with some silt and chert fragments.

No instrumentation (monuments, piezometers, etc.) was observed. No animal burrows were noted.

C. Appurtenant Structures:

C.1 Primary Spillway:

The approach area to the 30 inch diameter spillway pipe was clear. Silt accumulation at the spillway pipe entrance was observed. This buildup was approximately 3 inches. No provisions for a trash or debris screen were provided for at the inlet. The spillway outlet channel is well away from the embankment. Partial blockage of the spillway outlet pipe was noted. This is due to the brush and debris at and beyond the pipe outlet. No significant erosion was noted in the outlet channel.

C.2 Emergency Spillway:

There is no emergency spillway associated with this dam.

D. Reservoir:

The watershed is generally grass and tree covered with steep slopes. Construction of the adjacent golf course is associated with the erosion of the reservoir area. The golf course is scheduled for completion this spring. Future development includes lakeside home sites. No sloughing or serious erosion was noted. Sedimentation of the reservoir does not appear to be significant.

E. Downstream Channel:

The downstream channel is generally wooded with moderate side slopes. The Lake of the Ozarks is located several hundred yards downstream of the dam.

3.2 EVALUATION:

The trees, brush and undesirable vegetation growth on the dam are potential seepage hazards and can provide shelter for small animals and encourage burrowing. The apparent seepage from the toe of the embankment could adversely affect the stability of the dam. The erosion of the abutments-downstream embankment could worsen and also affect the stability of the embankment. The apparent seepage area and erosional area should be investigated by an engineer experienced in the design and construction of dams.

Photographs of the dam, appurtenant structures, and the reservoir are presented in Appendix D.

SECTION 4 - OPERATIONAL PROCEDURES

4.1 PROCEDURES:

There are no operating facilities associated with this dam. The pool is normally controlled by rainfall, runoff, evaporation, the capacity of the uncontrolled spillway pipe, and seepage from the reservoir.

4.2 MAINTENANCE OF DAM:

Information from the owner indicates that maintenance is performed on an as needed basis and is not scheduled on a set basis.

4.3 MAINTENANCE OF OPERATING FACILITIES:

There are no operating facilities for this dam.

4.4 DESCRIPTION OF ANY WARNING SYSTEM IN EFFECT:

The inspection team is unaware of any existing warning system for this dam.

4.5 EVALUATION:

The erosional area of the abutments-downstream embankment contact, and the apparent seepage at the downstream toe are deficiencies which should be corrected. Remedial measures should be investigated by an engineer experienced in the design and construction of dams. Subsequently these areas should be inspected periodically to detect any further erosion or seepage.

SECTION 5 - HYDRAULIC/HYDROLOGIC

5.1 EVALUATION OF FEATURES:

A. Design Data.

No hydrologic or hydraulic design computations for this dam were available.

B. Experience Data:

The hydraulic and hydrologic analyses were based on: (1) a field survey of spillway dimensions and embankment elevations, and (2) an estimate of the pool and drainage areas from the Lake Ozark, Missouri, 7.5 minute 1959 quad sheet, and a 1 foot contour interval map obtained from owner. The spillway operates occasionally and the owner reported the maximum flow to have been about midway of the spillway pipe. At the time of inspection the pool level was at normal pool. No high water marks or indication of overtopping were observed. All elevations are consistent with an assumed mean sea level elevation of 748.36 for the invert of the spillway inlet pipe (elevation obtained from owner).

Our hydrologic and hydraulic analyses using U. S. Army Corps of Engineers guidelines appear in Appendix C.

C. Visual Observations:

The approach channel to the spillway is clear. The spillway channel is well separated from the embankment, and spillway releases would not be expected to endanger the dam.

D. Overtopping Potential.

Based on the hydrologic and hydraulic analysis presented in Appendix C, the spillway will pass 19 percent of the Probable Maximum Flood. The Probable Maximum Flood is defined as the flood discharge that may be expected from the most severe combination of critical meteorologic and hydrologic conditions that are reasonably possible in the region. The recommended guidelines from the Department of the Army, Office of the Chief of Engineers, require that this structure (small size with high downstream hazard potential) pass 50 to 100 percent of the PMF. Considering the height of the dam (36 feet) and the volume of water impounded (53 acre-foot) and the dwellings downstream, 50 percent of the PMF has been determined to be the appropriate spillway design flood without overtopping. The structure will pass a 1 percent probability flood without overtopping.

The routing of the PMF through the spillway and dam indicates that the dam will be overtopped by 1.17 ft at elevation 752.47. The duration of the overtopping will be 8.25 hours, and the maximum outflow will be 939 cfs. The maximum discharge capacity of the spillway is 24 cfs. The routing of 50 percent of

the PMF indicates that the dam will be overtopped by 0.80 feet at elevation 752.10. The maximum outflow will be 457 cfs and the duration of overtopping will be 5.83 hours. Overtopping of an earthen embankment could cause serious erosion and could possibly lead to failure of the structure.

SECTION 6 - STRUCTURAL STABILITY

6.1 EVALUATION OF STRUCTURAL STABILITY:

A. Visual Observations:

Observed features which could adversely affect the structural stability of this dam are discussed in Sections 3.1B and 3.2.

B. Design and Construction Data:

No design and construction data for the foundation and embankment were available. Seepage and stability analyses comparable to the requirements of the guidelines were not available, which constitutes a deficiency which should be rectified.

C. Operating Records:

There are no operating records for this dam.

D. Post-Construction Changes:

There have not been any reported post-construction changes to the dam.

E. Seismic Stability:

The structure is located in seismic zone 1. An earthquake of this magnitude would not generally be expected to cause severe structural damage to a well constructed earth dam of this size. However, it is recommended that the prescribed seismic loading for this zone be applied in stability analyses performed for this dam.

SECTION 7 - ASSESSMENT/REMEDIAL MEASURES

7.1 DAM ASSESSMENT:

This Phase I inspection and evaluation should not be considered as being comprehensive since the scope of work contracted for is far less detailed than would be required for an in-depth evaluation of dams. Latent deficiencies, which might be detected by a totally comprehensive investigation, could exist.

A. Safety:

The embankment is in less than satisfactory condition. Several items were noted during the visual inspection which should be investigated further, corrected or controlled. These items are: (1) Small tree growth on the upstream face of the embankment; (2) Brush and weed growth on the downstream face of the embankment; (3) Brush and debris partially blocking the spillway pipe outlet; (4) Soft marshy area at the downstream toe of the embankment near center of dam; (5) Minor erosion channels at the abutment-downstream embankment contact; and (6) Lack of wave protection for the upstream embankment face.

Another deficiency was the lack of seepage and stability analyses records.

The dam will be overtopped by flows in excess of 19 percent of the Probable Maximum Flood. Overtopping of an earthen embankment could cause serious erosion and could possibly lead to failure of the structure.

B. Adequacy of Information:

The conclusions in this report were based on the performance history as related by others, and visual observation of external conditions. The inspection team considers that these data are sufficient to support the conclusions herein. Seepage and stability analyses comparable to the "Recommended Guidelines for Safety Inspection of Dams" were not available, which is considered a deficiency.

C. Urgency:

The remedial measures recommended in paragraph 7.2 should be accomplished in the near future. If the deficiencies listed in paragraph A are not corrected, and if good maintenance is not provided, the embankment condition will continue to deteriorate and possibly could become serious in the future. The items recommended in paragraph 7.2A should be pursued without undue delay.

D. Necessity for Additional Inspection.

Based on the result of the Phase I inspection, no additional inspection is recommended.

E. Seismic Stability:

The structure is located in seismic zone I. An earthquake of this magnitude would not generally be expected to cause severe structural damage to a well constructed earth dam of this size. However, it is recommended that the prescribed seismic loading for this zone be applied in any stability analyses performed for this dam.

7.2 REMEDIAL MEASURES:

The following remedial measures and maintenance procedures are recommended. All remedial measures should be performed under the guidance of a professional engineer experienced in the design and construction of dams.

A. Alternatives:

- (1) Spillway size and/or height of dam should be increased to pass 50 percent of the PMF. In either case, the spillway should be protected to prevent erosion.


B. O & M Procedures:

- (1) Seepage and stability analyses comparable to the requirements of the recommended guidelines should be performed by an engineer experienced in the design and construction of dams.
- (2) The apparent seepage area at the downstream toe near the center of the dam should be investigated by an engineer experienced in the design and construction of dams. Remedial measures may be required. As a minimum, the marshy area should be drained and monitored to determine if there is any appreciable flow and if soil particles are present in the flow.
- (3) Erosional areas should be repaired and seeded.
- (4) Wave protection should be provided for the upstream face of the dam.
- (5) Tree and brush growth should be removed from the faces of the embankment. Removal of trees should be under the supervision of an engineer experienced in the design and construction of dams. Indiscriminate clearing methods could jeopardize the safety of the dam.


- (6) The vegetative growth on the dam should be cut annually.
- (7) Trash protective screen should be provided at the inlet of the spillway pipe.
- (8) A detailed inspection of the dam should be made periodically by an engineer experienced in the design and construction of dams.

APPENDIX A

Dam Location and Plans

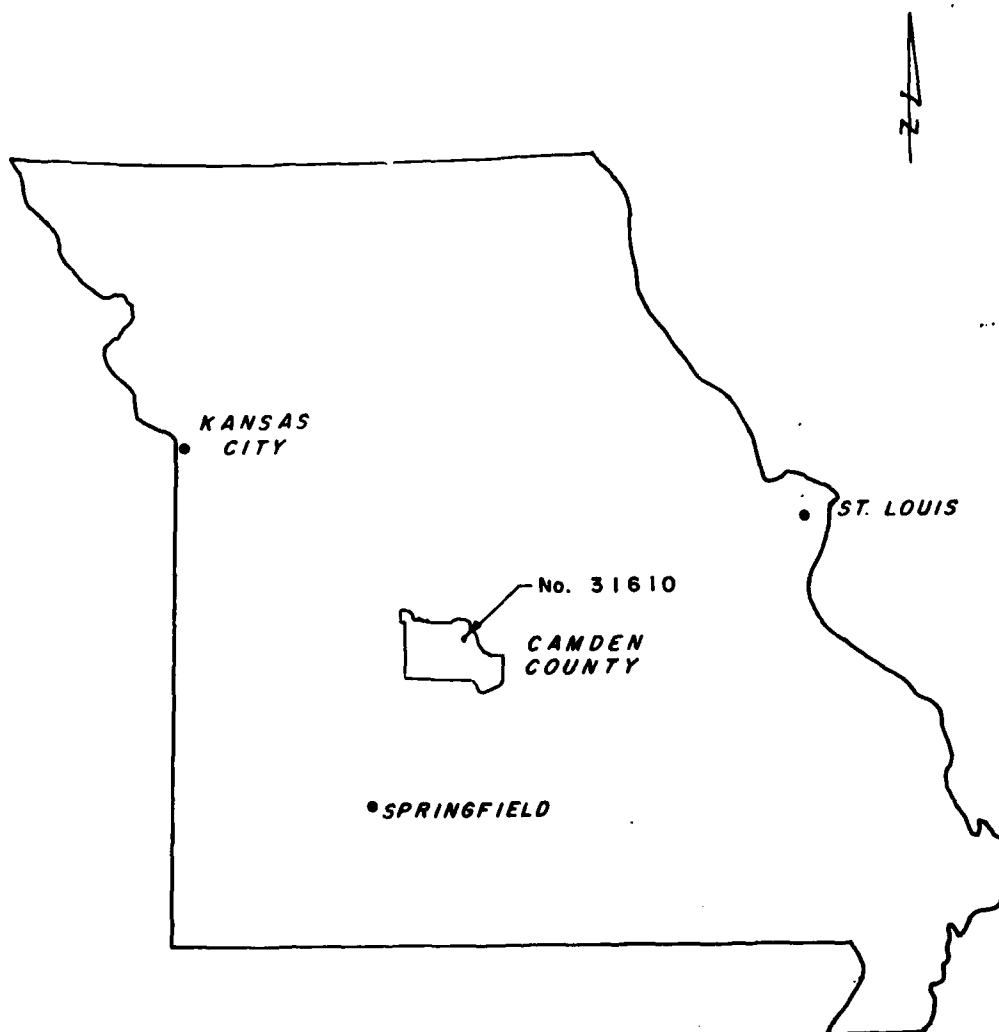

LOCATION MAP

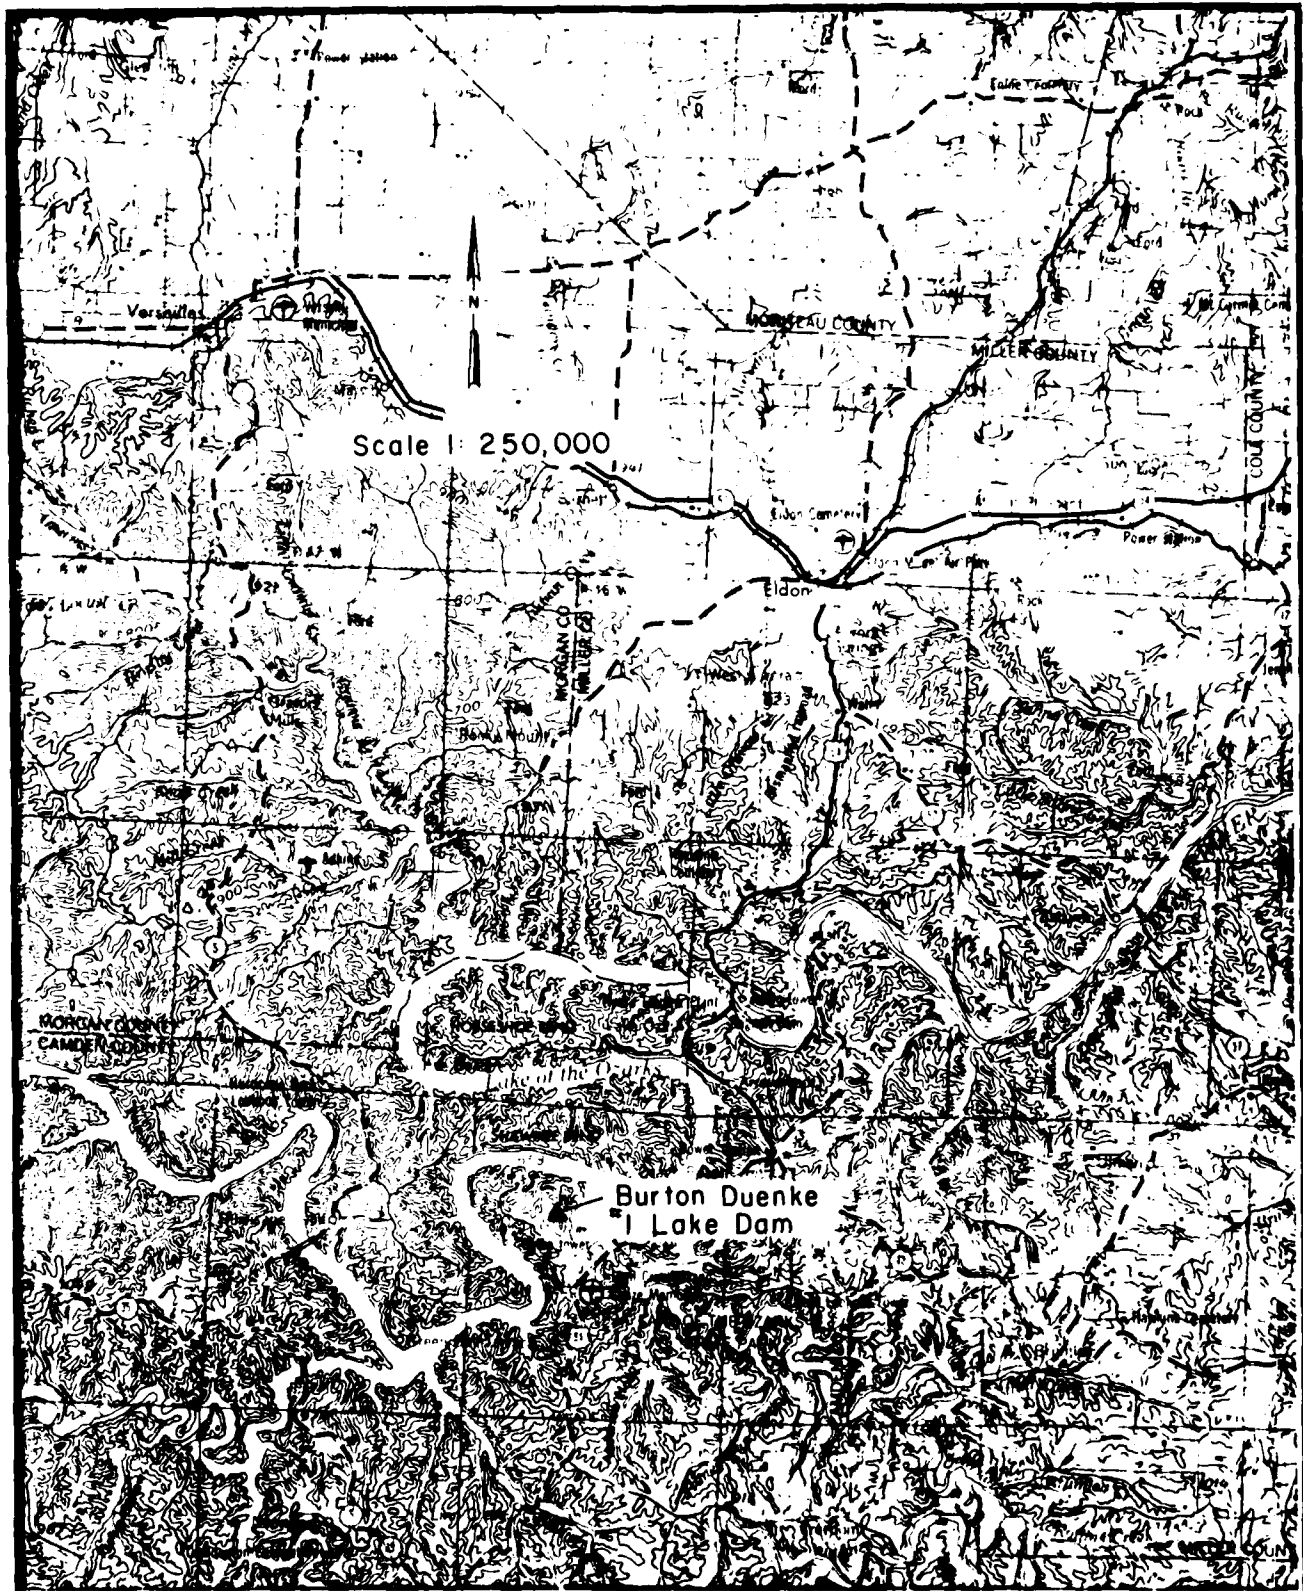


VICINITY MAP




SPRINGFIELD, IL • PEORIA, IL • ROCKFORD, IL

Burton Duenke #1 Lake Dam
Camden County, Missouri
Mo. I.D. No. 31610



Sheet 2, Appendix A

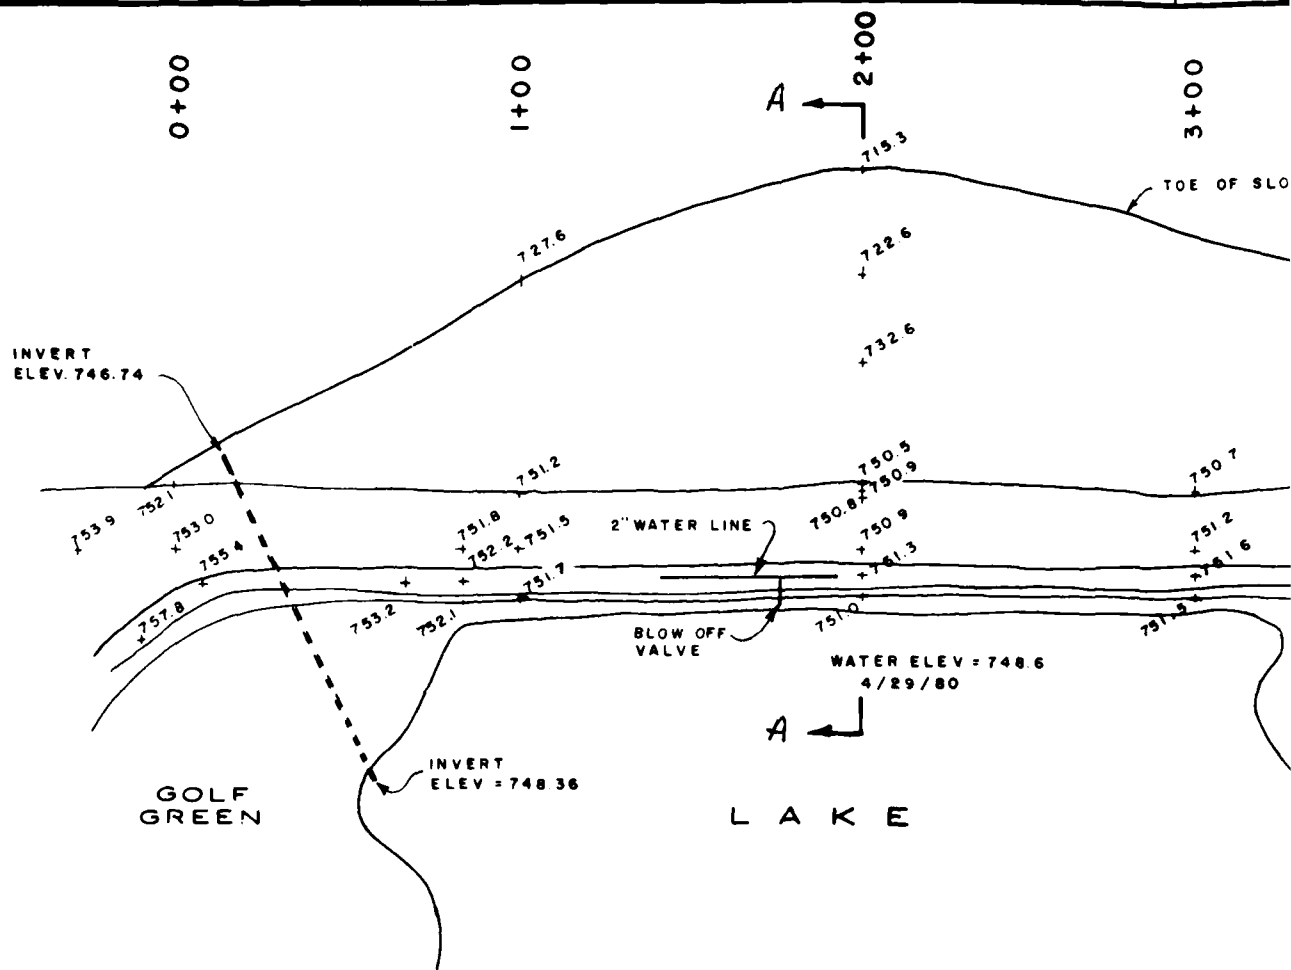


PLAN VIEW
SCALE: 1" = 50'

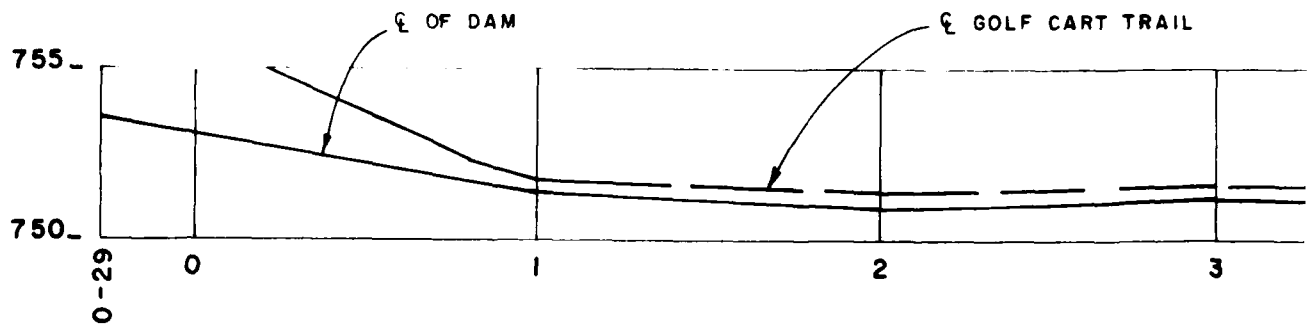


PROFILE

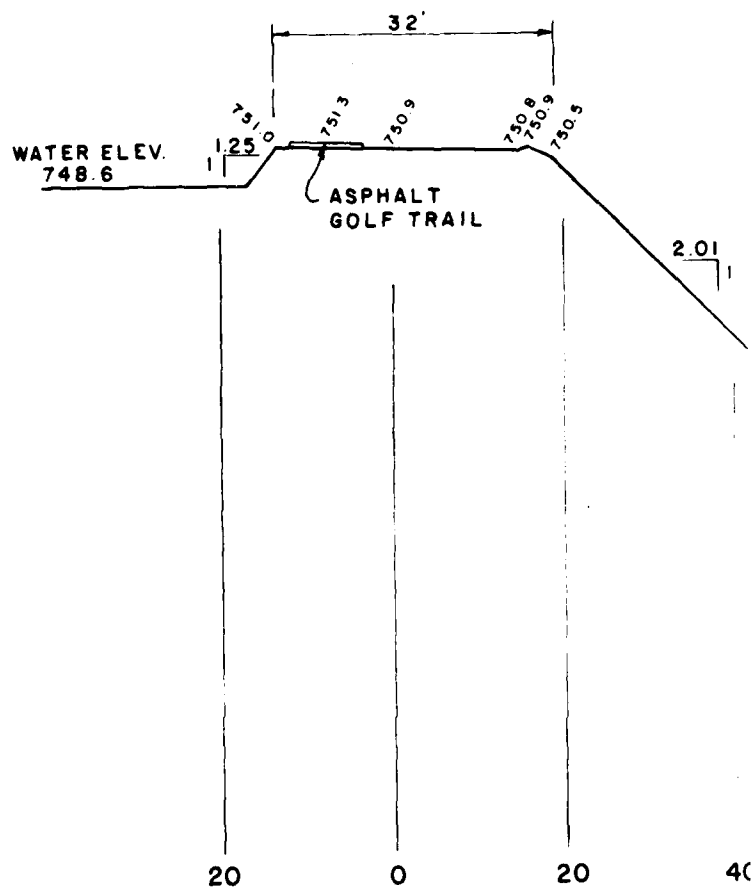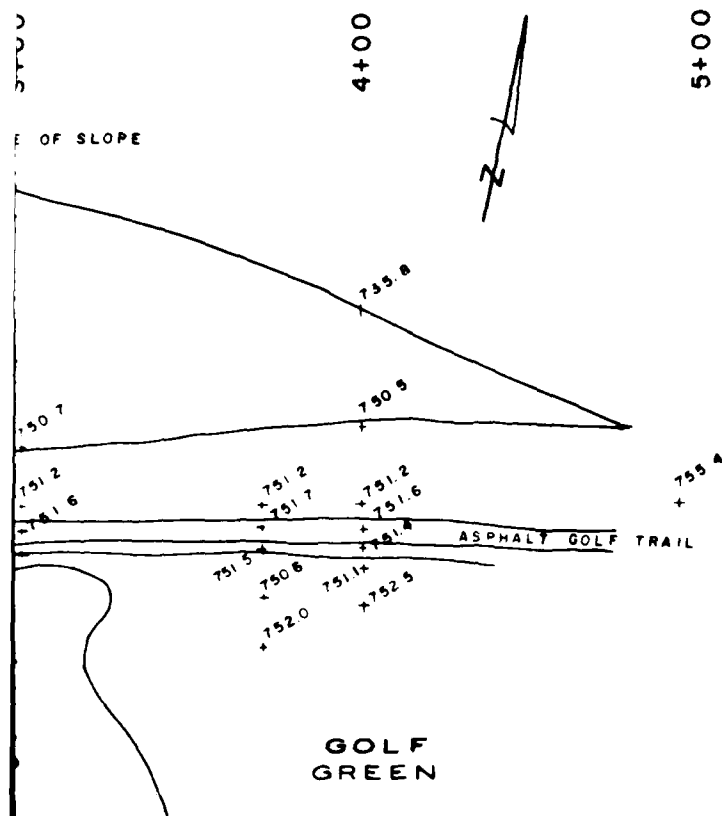

SECTION A-A S

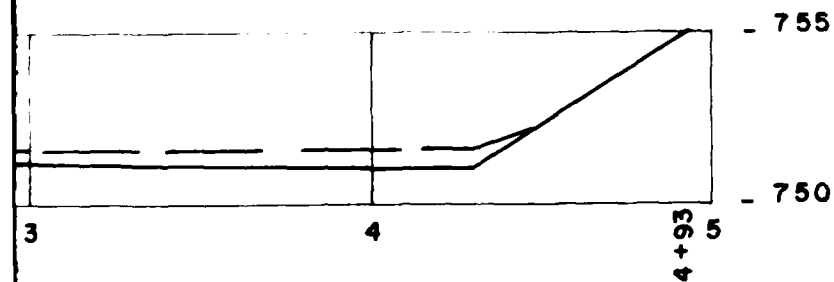

2

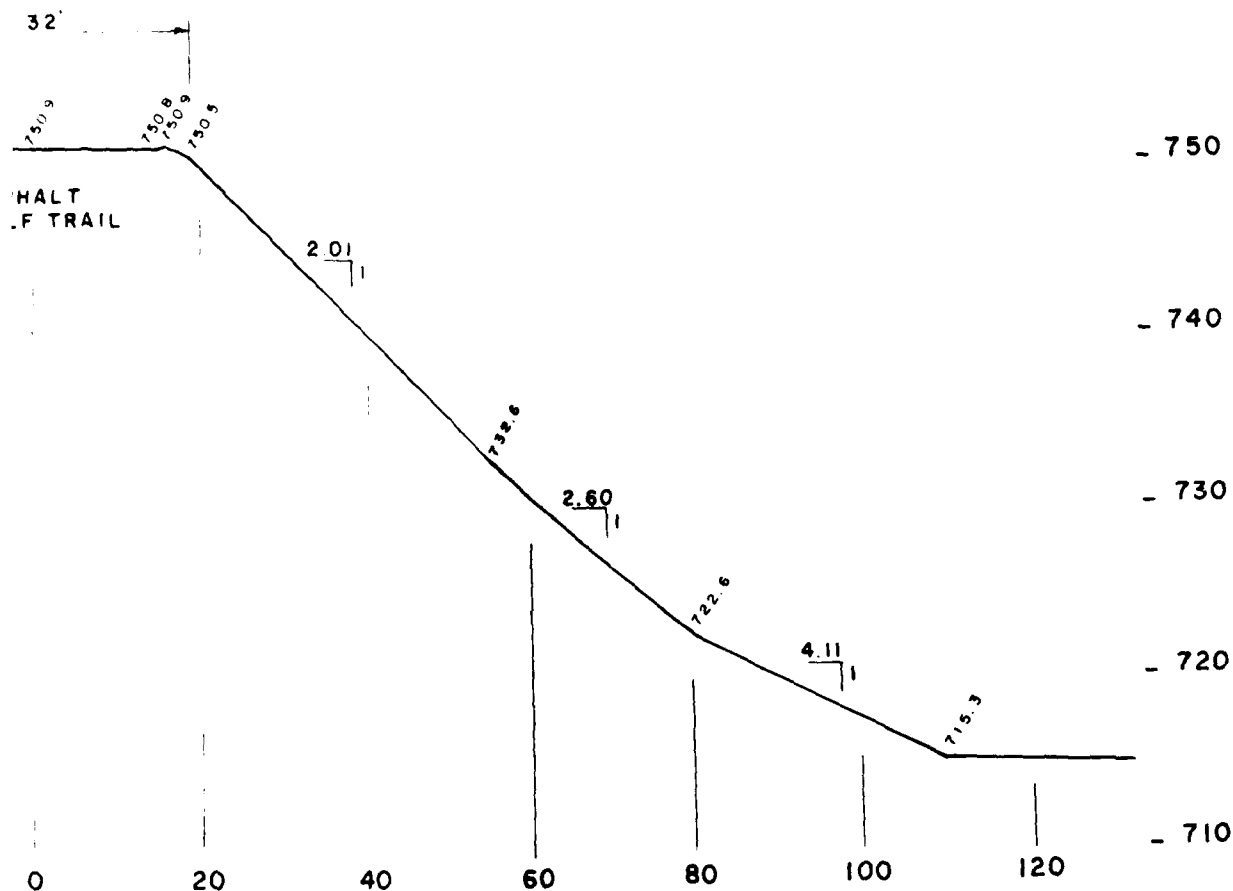

SECTION A-A STA 2+00

SHEET 3 APPENDIX A

ANDERSON ENGINEERING, INC.
730 NORTH BENTON AVENUE
SPRINGFIELD, MISSOURI 65802

BURTON DUENKE #1

MO. No. 31610

PLAN & PROFILE

CAMDEN COUNTY, MO.

3

4+00

3+00

TOE OF
SLOPE

SEEPAGE
AREA

2+00

1+00

0+00

DEBRIS

GOLF
GREEN

NORTH

ASPHALT GOLF CART TRAIL

LAKE

BLOW OFF
VALVE

2" WATER LINE


SPILLWAY PIPE

GOLF
GREEN

PLAN SKETCH OF DAM

BURTON DUENKE #1

MO. No. 31610

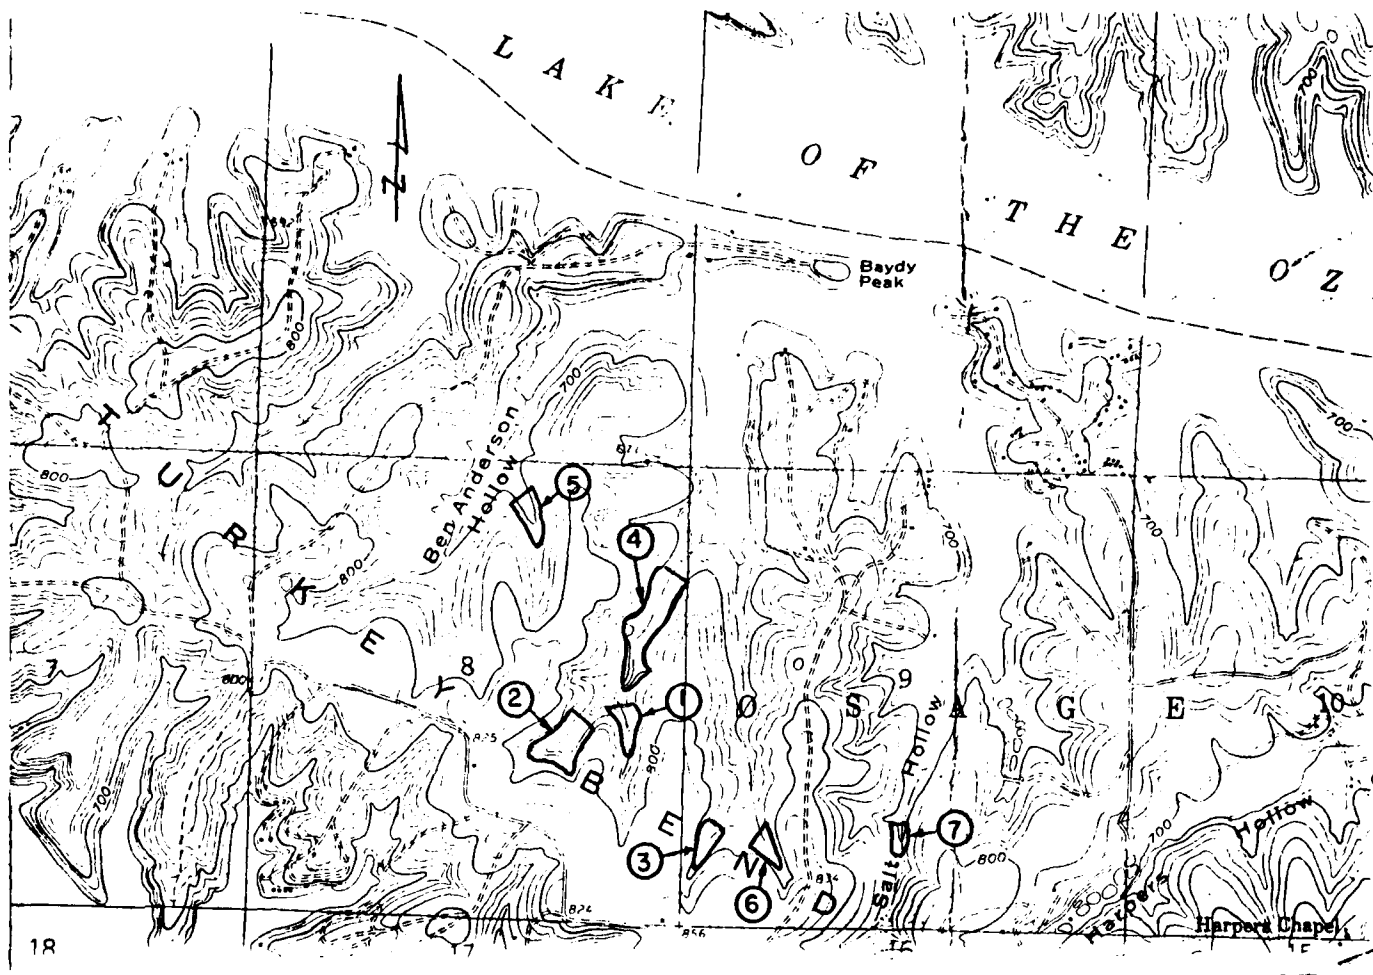

TOPOGRAPHIC MAP OF AREA DAMS
SCALE: 1:24,000


INDEX KEY

<u>KEY No.</u>	<u>MO. I. D. No.</u>	<u>DAM NAME</u>
1	31610	BURTON DUENKE #1
2	31611	BURTON DUENKE #2
3	31609	BURTON DUENKE #3
4	31713	BURTON DUENKE #4
5	—	—
6	—	—
7	—	—

BURTON DUENKE #1 LAKE DAM
CAMDEN COUNTY, MISSOURI
MO. I. D. No. 31610

APPENDIX B

Geology and Soils



LEGEND

GLACIATED
PLAINS



WESTERN
PLAINS




OZARKS



ST. FRANCOIS
MOUNTAINS



SOUTHEASTERN
LOWLANDS

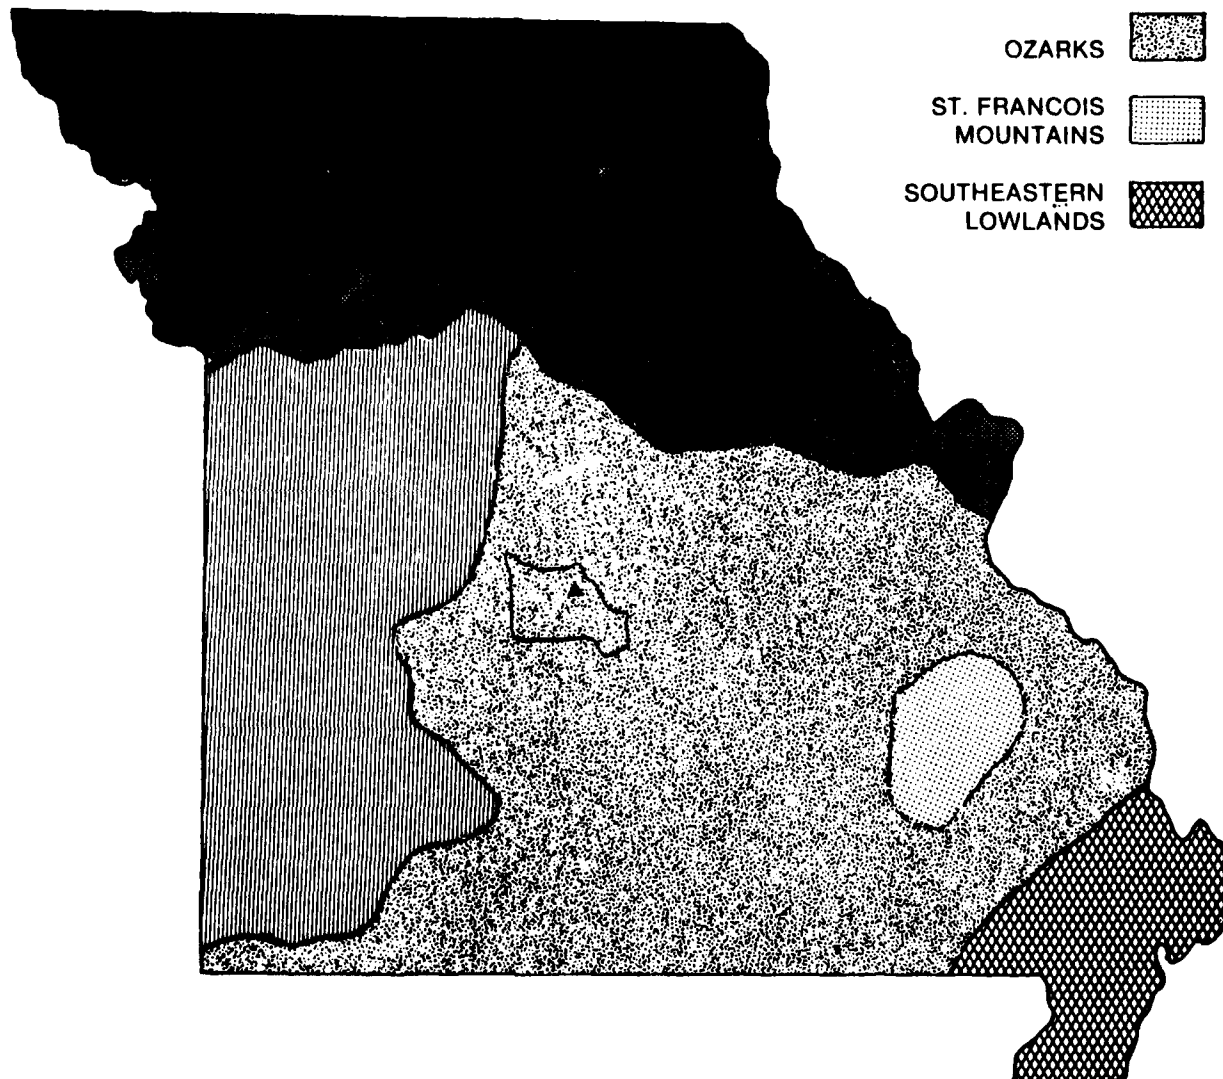


MAJOR GEOLOGIC REGIONS OF MISSOURI



SPRINGFIELD, IL • PEORIA, IL • ROCKFORD, IL

Burton DuenkeTM I Lake Dam
Camden County, Missouri
Mo. I.D. No. 31610

SHEET 1, APPENDIX B

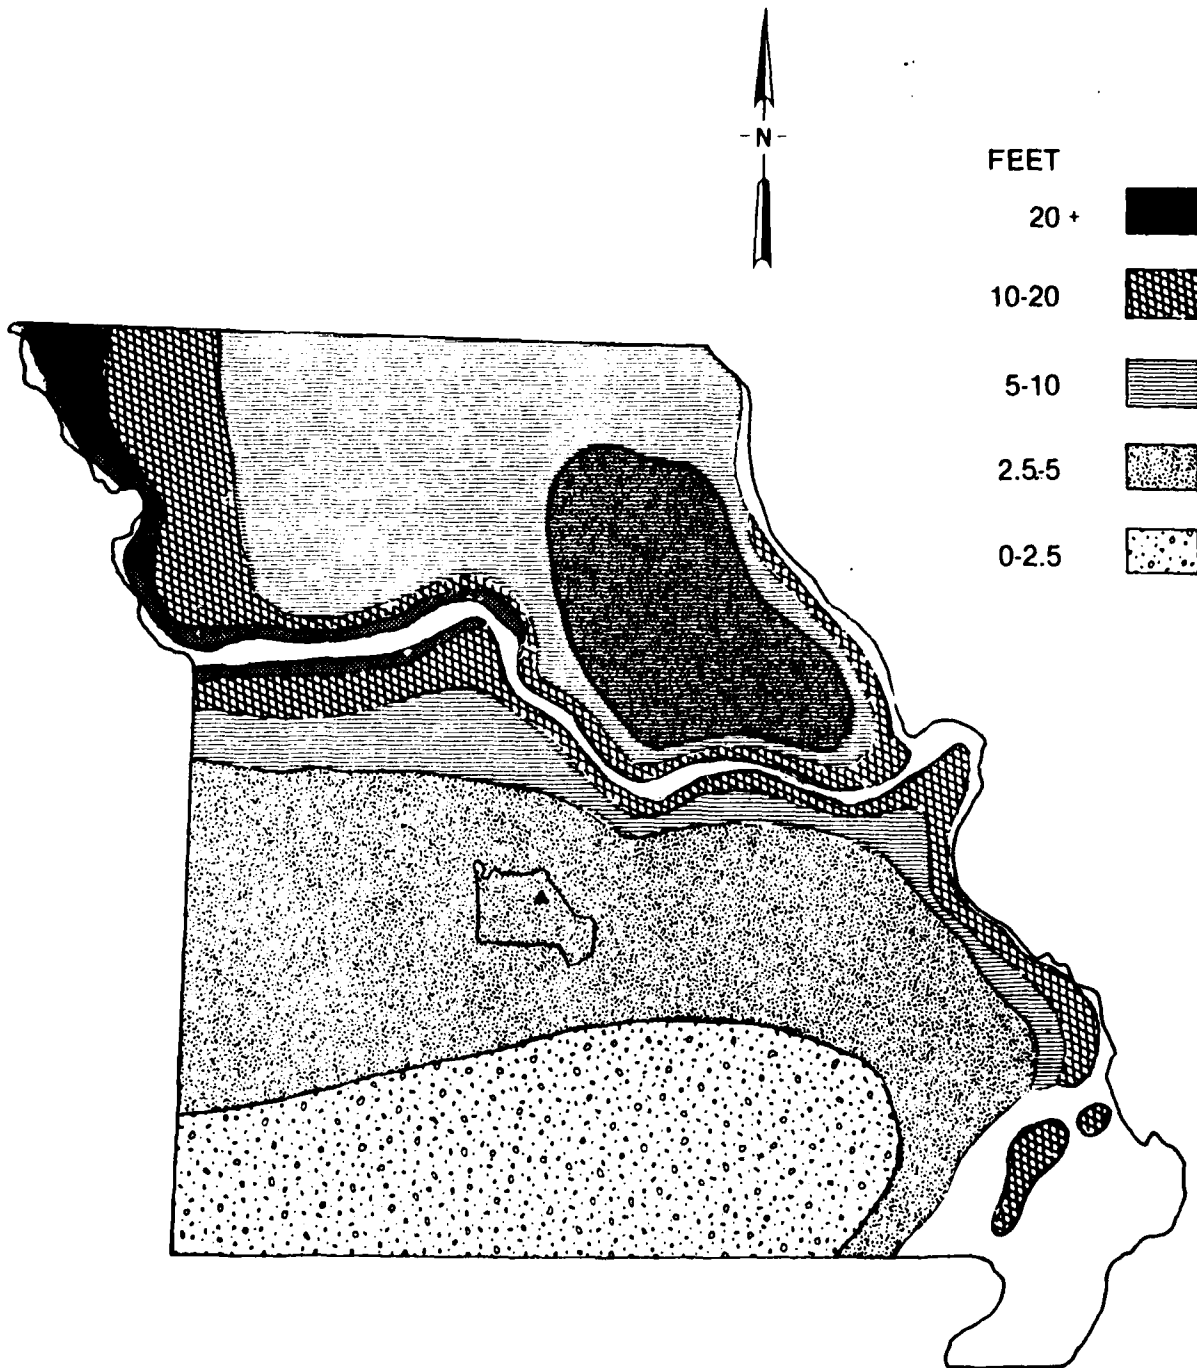

THICKNESS OF LOESSIAL DEPOSITS




SPRINGFIELD, IL • PEORIA, IL • ROCKFORD, IL

Burton Duenke[®] 1 Lake Dam
Camden County, Missouri
Mo. I.D. No. 31610

SHEET 2, APPENDIX B

APPENDIX C

Overtopping Analysis

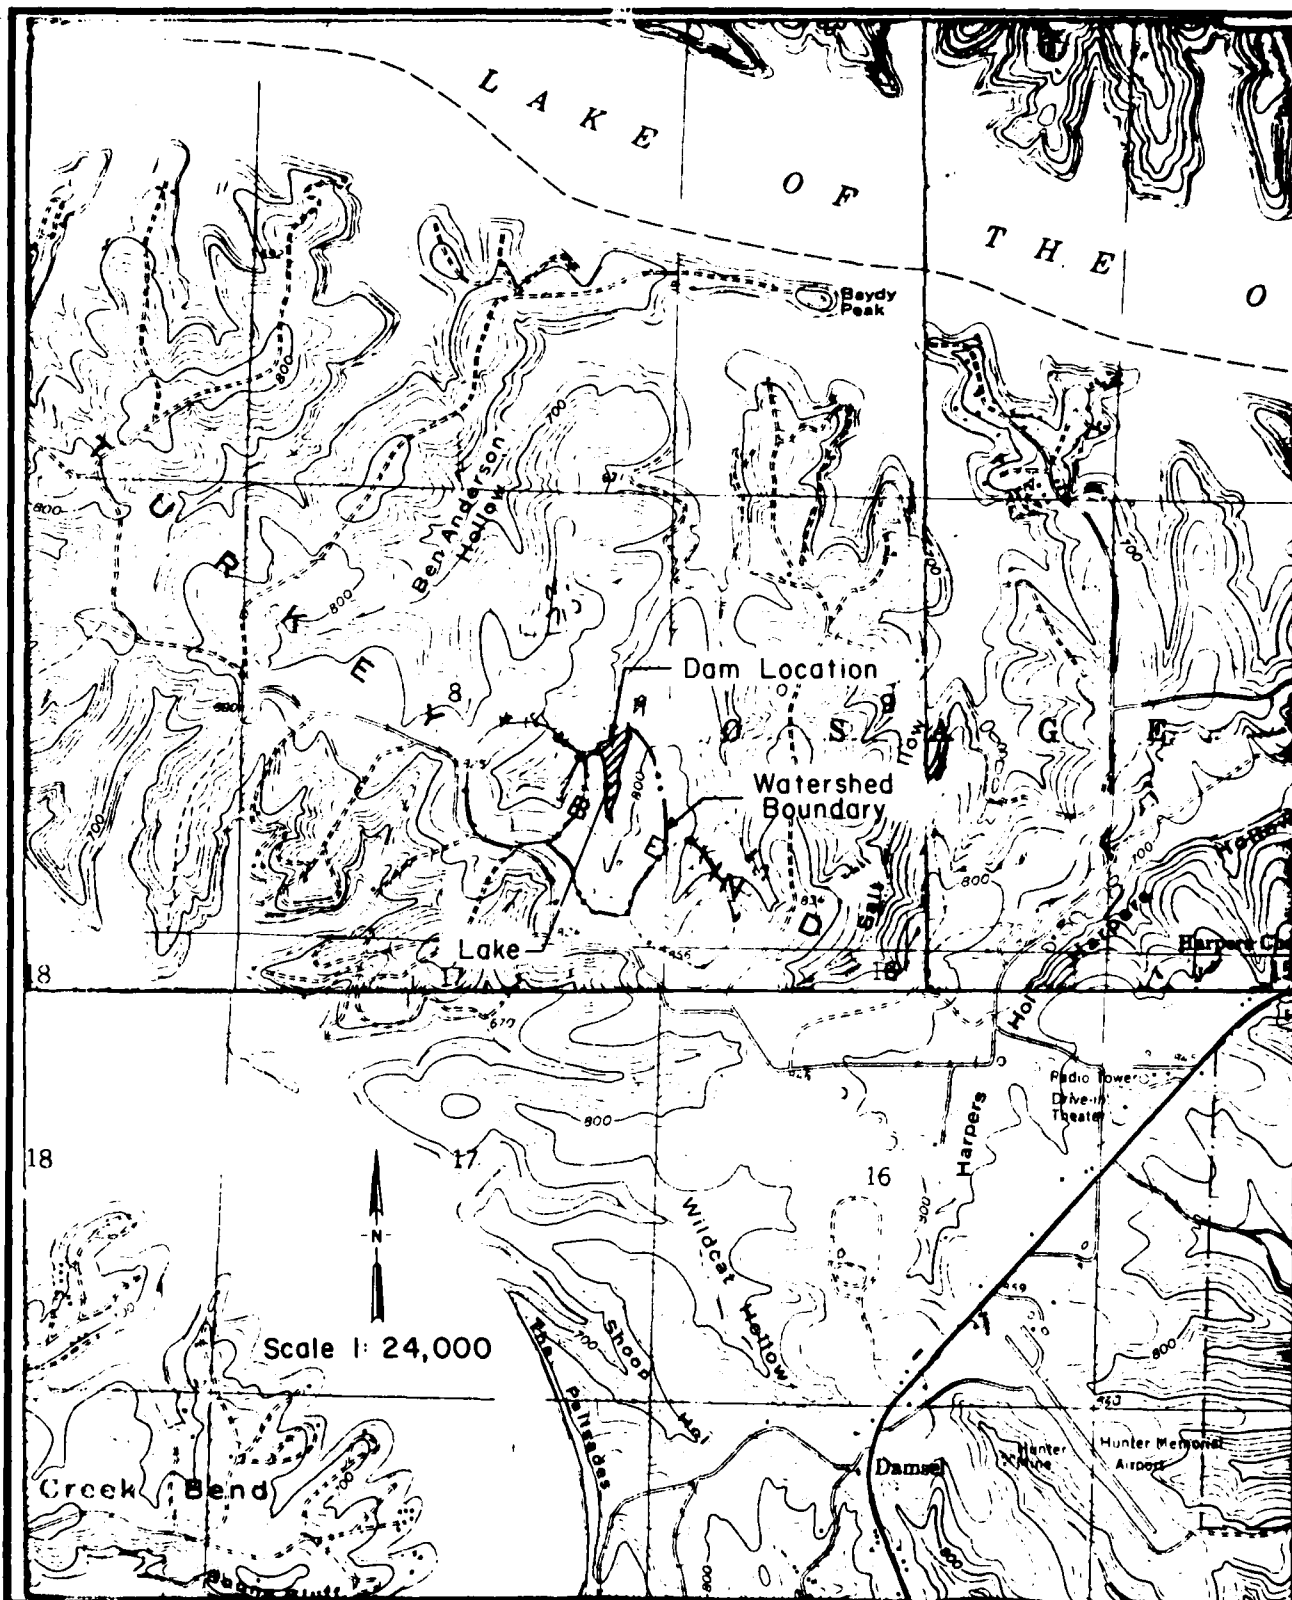

LAKE AND WATERSHED MAP



SPRINGFIELD, IL • PEORIA, IL • ROCKFORD, IL

Burton Duenke[®] I Lake Dam
Camden County, Missouri
Mo. I. D. No. 31610

Sheet I, Appendix C

APPENDIX C

HYDROLOGIC AND HYDRAULIC ANALYSIS

To determine the overtopping potential, flood routings were performed by applying the Probable Maximum Precipitation (PMP) to a synthetic unit hydrograph to develop the inflow hydrograph. The inflow hydrograph was then routed through the reservoir and spillway. The overtopping analysis was accomplished using the systemized computer program HEC-1 (Dam Safety Version), July 1978, prepared by the Hydrologic Engineering Center, U.S. Army Corps of Engineers, Davis, California.

The PMP was determined from regional charts prepared by the National Weather Service in "Hydrometeorological Report No. 33." Reduction factors were not applied. The rainfall distribution for the 24-hour PMP storm duration was assumed according to the procedures outlined in EM 1110-2-1411 (SPD Determination). Also, the 1 percent chance probability flood was routed through the reservoir and spillway. Warsaw rainfall distribution, as provided by the St. Louis District, Corps of Engineers, was used in this case.

The synthetic unit hydrograph for the watershed was developed by the computer program using the SCS method. The parameters for the unit hydrograph are shown in Table 1 (Sheet 3, Appendix C).

The SCS curve number (CN) method was used in computing the infiltration losses for rainfall-runoff relationship. The CN values used, and the result from the computer output, are shown in Table 2 (Sheet 4, Appendix C).

The reservoir routing was accomplished by using the Modified Puls Method. The hydraulic capacity of the spillway was used as an outlet control in the routing. The hydraulic capacity of the spillway and the storage capacity of the reservoir were defined by the elevation-surface area--storage-discharge relationships shown in Table 3 (Sheet 4, Appendix C).

The rating curve for the spillway (see Table 4, Sheet 5, Appendix C) was determined using charts for corrugated-metal pipe with enhance and full flow control, from the U.S. Bureau of Public Roads.

The flow over the crest of the dam during overtopping was determined using the non-level dam option (\$L and \$V cards) of the HEC-1 program. The program assumes critical flow.

A summary of the routing analysis for different ratios of the PMF is shown in Table 5 (Sheet 6, Appendix C).

The computer input data, a summary of the output data, and a plot of the inflow-outflow hydrograph for the PMF are presented on Sheets 7, 8 and 9 of Appendix C.

TABLE 1
SYNTHETIC UNIT HYDROGRAPH

Parameters:

Drainage Area (A)	0.063 sq. miles
Length of Watercourse (L)	0.25 miles
Difference in elevation (H)	107 feet
Time of concentration (Tc)	0.09 hours
Lag Time (Lg)	0.05 hours
Time to peak (Tp)	0.09 hours
Peak Discharge (Qp)	326 cfs
Duration (D)	5 min.

<u>Time (Min.) (*)</u>	<u>Discharge (cfs) (*)</u>
0	0
5	326
10	125
15	29
20	7
25	1

(*) From the computer output

FORMULA USED:

$$T_c = \left(\frac{11.9 L^3}{H} \right) \quad 0.385$$

$$L_g = 0.6 T_c$$

$$T_p = \frac{D}{2} + L_g$$

$$Q_p = \frac{484 A \cdot Q}{T_p} \quad Q = \text{Excess Runoff} = 1 \text{ inch}$$

TABLE 2
RAINFALL-RUNOFF VALUES

<u>Selected Storm Event</u>	<u>Storm Duration (Hours)</u>	<u>Rainfall (Inches)</u>	<u>Runoff (Inches)</u>	<u>Loss (Inches)</u>
PMP	24	33.41	30.56	2.85
1% Prob. Flood	24	7.69	3.56	4.13

Additional Data:

- 1) Soil Conservation Service Soil Group B
- 2) Soil Conservation Service Runoff Curve CN = 78 (AMC III) for the PMF
- 3) Soil Conservation Service Runoff Curve CN = 60 (AMC II) for the
1 percent chance flood
- 4) Percentage of Drainage Basin Impervious 10 percent

TABLE 3
ELEVATION, SURFACE AREA, STORAGE AND DISCHARGE RELATIONSHIPS

<u>Elevation (feet-MSL)</u>	<u>Lake Surface Area (acres)</u>	<u>Lake Storage (acre-ft)</u>	<u>Spillway Discharge (cfs)</u>
722.0	0	0	-
730.0	0.7	4	-
740.0	2.0	18	-
*748.4	3.7	42	0
750.0	3.9	48	10
**751.3	4.2	53	24
760.0	5.9	97	-

*Primary spillway crest elevation

**Top of dam elevation

TABLE 4
SPILLWAYS RATING CURVE

<u>Reservoir Elevation Feet, MSL</u>	<u>Primary Spillway Flow, CFS</u>
748.4	0
749.0	4
750.0	10
751.0	20
751.3	24
752.0	28
753.0	33
754.0	37
755.0	41

*Top of dam elevation

METHOD USED:

Charts for corrugated-metal pipes with entrance and full flow control, from the U.S. Bureau of Public Roads, were used.

TABLE 5
RESULTS OF FLOOD ROUTINGS

Ratio of PMF	Peak Inflow (CFS)	Peak Lake Elevation (ft.-MSL)	Total Storage (AC.-FT.)	Peak Outflow (CFS)	Depth (ft.) Over Top of Dam
-	0	*748.4	42	0	-
0.10	113	750.1	48	11	-
0.19	215	**751.3	53	24	0
0.20	226	751.4	54	28	0.10
0.25	282	751.7	55	88	0.35
0.30	339	751.8	56	192	0.52
0.35	395	751.9	56	299	0.64
0.40	451	752.0	57	358	0.71
0.50	564	752.1	57	457	0.80
0.75	846	752.3	58	699	1.00
1.00	1129	752.5	59	939	1.17

The percentage of the PMF that will reach the top of the dam is 19 percent.

*Primary spillway crest elevation

**Top of dam elevation

300 5

0.05

БЫТИЕ ИЛИ НЕБЫТИЕ

—

42 -1

Y4 748.4	749	750	751	751.3	752	753	754	755
----------	-----	-----	-----	-------	-----	-----	-----	-----

	730	731	732	733	734	735
Y4 . . .	4	10	24	33	37	41
Y5 . . .	4	10	28	33	37	41

13	0	4	10	20	24	28	33	37	41
18	0	4	18	42	48	57			

98	0	4	18	42	48	53	97
95	752	770	740	748	758	751	718

9E	722	730	740	748.4	750	751.3	760

98 748.4

00 751.3

9L	0	83	180	305	330	370	415	470
9L	0	83	180	305	330	370	415	470

	751.3	751.4	751.6	751.7	752.1	753.2	754	755
0V	751.3	751.4	751.6	751.7	752.1	753.2	754	755

[illegible]

1

1. The first part of the document is a list of names and titles, including "The Hon. Mr. Justice" and "The Hon. Mr. Justice".

[illegible]

1

Sheet 7, Appendix C

PEAK FLOW AND STORAGE (END OF PERIOD) SUMMARY FOR MULTIPLE PLAN-RATIO ECONOMIC COMPUTATIONS
 FLOWS IN CUBIC FEET PER SECOND (CUBIC METERS PER SECOND)
 AREA IN SQUARE MILES (SQUARE KILOMETERS)

OPERATION	STATION	AREA	PLAN	RATIOS APPLIED TO FLOWS							
				RATIO 1	RATIO 2	RATIO 3	RATIO 4	RATIO 5	RATIO 6	RATIO 7	RATIO 8
				0.10	0.20	0.25	0.30	0.35	0.40	0.50	0.75
HYDROGRAPH AT	1	0.06	1	113.	226.	282.	339.	395.	451.	564.	846.
	(0.16)	(3.20)	(6.39)	(7.99)	(9.59)	(11.19)	(12.78)	(15.98)	(23.97)
ROUTED TO	2	0.06	1	11.	28.	88.	192.	299.	358.	457.	699.
	(0.16)	(0.30)	(0.79)	(2.50)	(5.44)	(8.47)	(10.15)	(12.94)	(19.79)

SUMMARY OF DAM SAFETY ANALYSIS


PLAN 1		INITIAL VALUE		SPILLWAY CREST		TOP OF DAM	
ELEVATION		748.40		748.40		751.30	
STORAGE		42.		42.		53.	
OUTFLOW		0.		0.		24.	

RATIO OF PMF	MAXIMUM RESERVOIR U.S. ELEV	MAXIMUM DEPTH OVER DAM	MAXIMUM STORAGE AC-FT	MAXIMUM OUTFLOW CFS	DURATION OVER TOP HOURS	TIME OF MAX OUTFLOW HOURS	TIME OF FAILURE HOURS
0.10	750.06	0.00	48.	11.	0.00	18.08	0.00
0.20	751.40	0.10	54.	28.	2.75	17.00	0.00
0.25	751.65	0.35	55.	88.	3.42	15.83	0.00
0.30	751.82	0.52	56.	192.	3.92	15.67	0.00
0.35	751.94	0.64	56.	299.	4.25	15.67	0.00
0.40	752.01	0.71	57.	358.	4.92	15.67	0.00
0.50	752.10	0.80	57.	457.	5.83	15.67	0.00
0.75	752.30	1.00	58.	699.	7.33	15.67	0.00
1.00	752.47	1.17	59.	939.	8.25	15.67	0.00

PMF Ratios
 OUTPUT DATA

INFLOW-OUTFLOW
HYDROGRAPH
FOR THE P.M.F.

Max. Inflow = 1129 cfs
Max. Outflow = 939 cfs

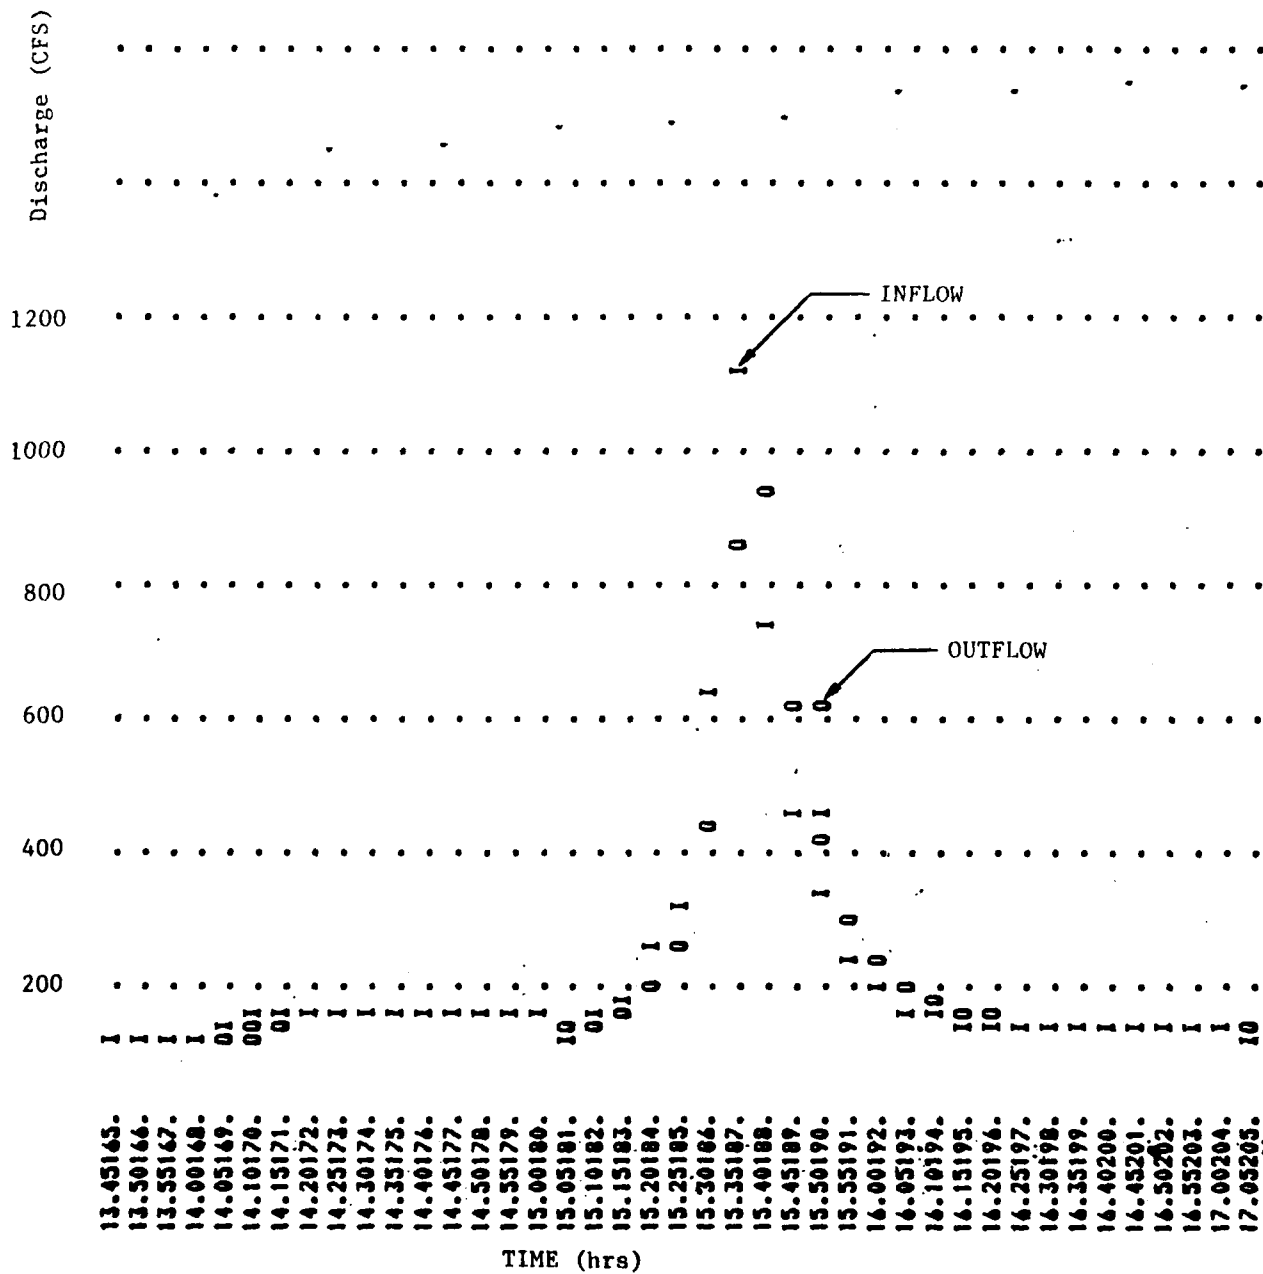

APPENDIX D

Photographs

4+00

3+00

2+00

1+00

0+00

18

11

9

19

SEEPAGE
AREA

20

8

BLOW OFF
VALVE

2" WATER LINE

SPILLWAY PIPE

13

DEBRIS

14

16

12


17

GOLF
GREEN

10

4

2

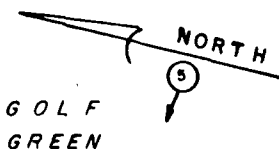

GOLF
GREEN

ASPHALT GOLF CART TRAIL

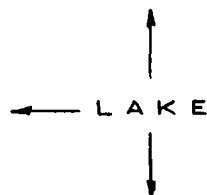


PHOTO INDEX



BURTON DUENKE #1

MO. No. 31610

LIST OF PHOTOGRAPHS

PHOTO NO.

- 1 Aerial View of Lake and Dam
- 2 Aerial View of Adjacent Lakes and Dams
- 3 Aerial View of Lake and Dam
- 4 Upstream Face of Dam - Looking Northeast
- 5 Upstream Face of Dam - Looking West
- 6 Upstream Face of Dam and Lower Lake and Dam -
Looking North
- 7 Upstream Face of Dam and Lower Lake and Dam
- 8 View of Lake and Watershed - Looking Southeast
- 9 View of Lake and Watershed - Looking South
- 10 Crest of Dam - Looking Toward East Abutment
- 11 Crest of Dam - Looking Toward West Abutment
- 12 Crest and Downstream Embankment - Looking Toward
East Abutment
- 13 Spillway Inlet Pipe - Looking Northwest
- 14 Debris at Outlet of Pipe - Looking South
- 15 Debris at Outlet of Pipe and Spillway Channel -
Looking South
- 16 Downstream View of Spillway Channel
- 17 Downstream Face of Dam - Looking Toward East Abutment
- 18 Downstream Face of Dam - Looking Toward West Abutment
- 19 Marshy Area at Toe of Embankment - Looking South
- 20 Marshy Area at Toe of Embankment - Looking Northeast

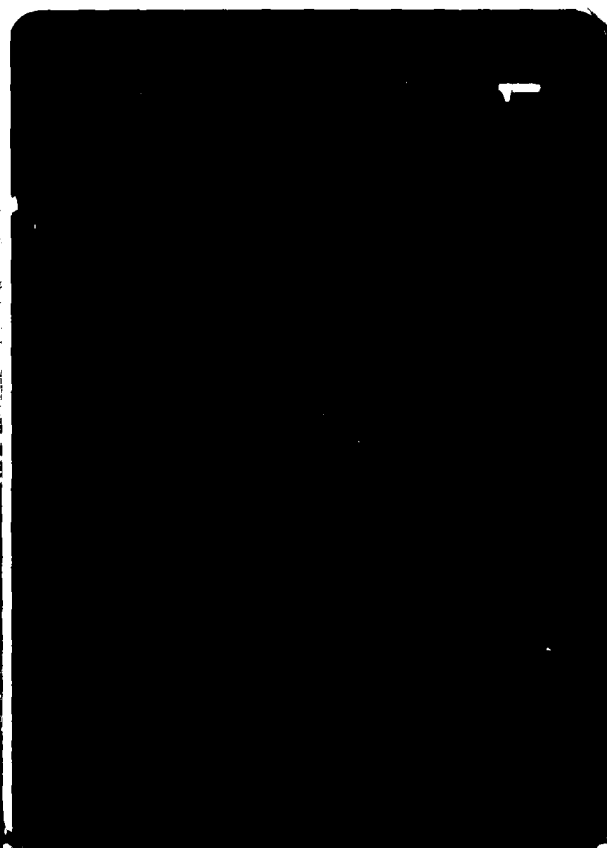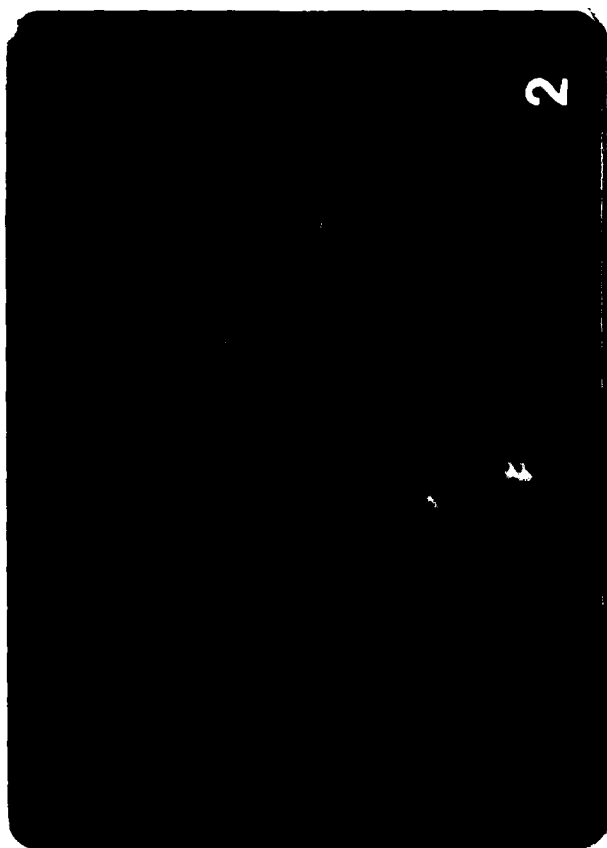



()


8

6

7

5

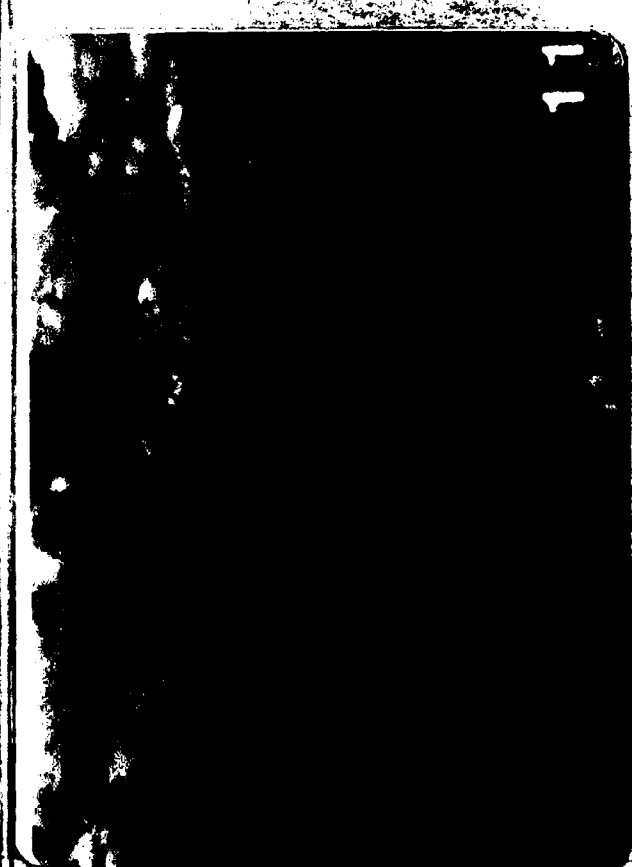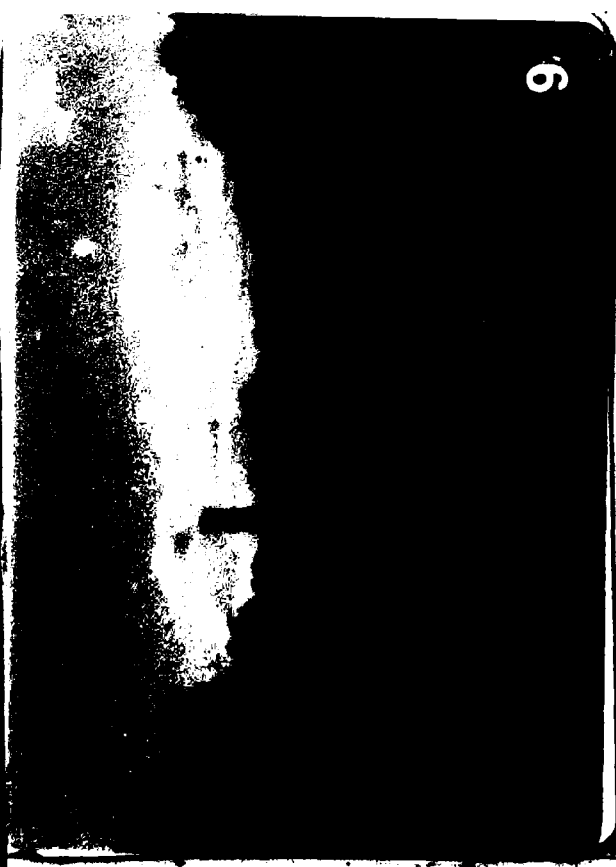

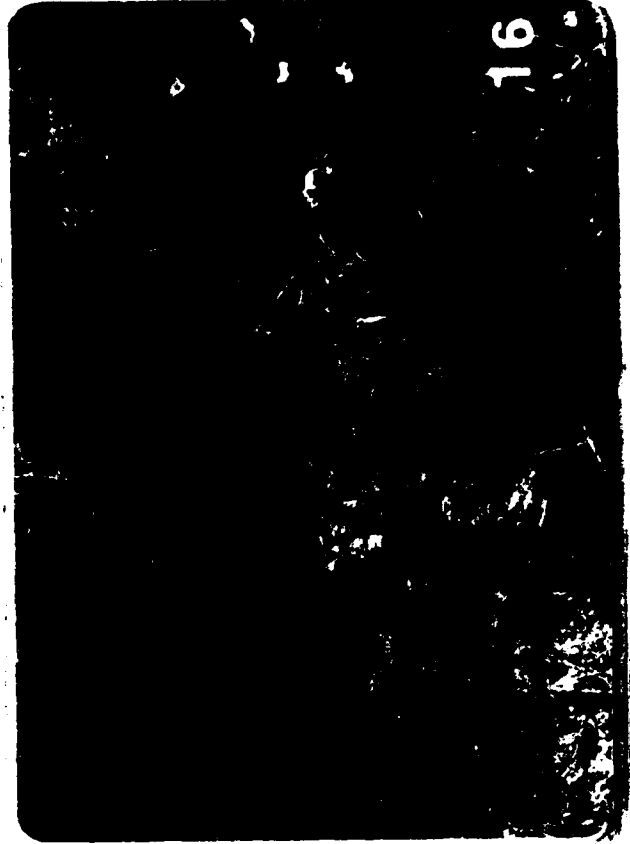

13 14 15 16

11


12



17



18

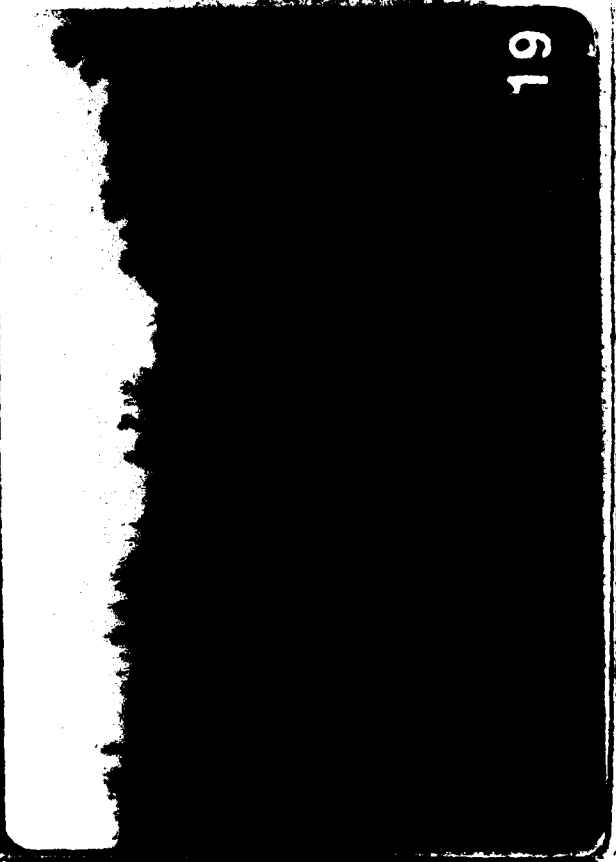

19



20

END

DATE
FILMED

11-81

DTIC